

Vision Sensor

VG Series

User Manual



Autonics

Preface

Thank you for purchasing an Autonics product.

This user manual contains information about the product and its proper use, and should be kept in a place where it will be easy to access.

Autonics

User Manual Guide

- Please familiarize yourself with the information in this manual before using the product.
- This manual provides detailed information on the product's features. It does not offer any guarantee concerning matters beyond the scope of this manual.
- This manual may not be edited or reproduced in either part or whole without permission.
- This programming manual is not provided as part of the product package. Please visit our home-page (www.autonics.com) to download a copy.
- The manual's content may vary depending on changes to the product's software and other unforeseen developments within Autonics, and is subject to change without prior notice. Upgrade notice is provided through our homepage.
- We contrived to describe this manual more easily and correctly. However, if there are any corrections or questions, please notify us these on our homepage.

User Manual Symbols

Symbol	Description
Note	Supplementary information for a particular feature.
Marning	Failure to follow instructions can result in serious injury or death.
A Caution	Failure to follow instructions can lead to a minor injury or product damage.
Ex.	An example of the concerned feature's use.
※1	Annotation mark.

Safety Considerations

Following these safety considerations will ensure the safe and proper use of the product and help prevent accidents, as well as minimizing possible hazards.

Safety considerations are categorized as Warnings and Cautions, as defined below:

Warning	Warning	Failure to follow the instructions may lead to a serious injury or accident.
----------------	---------	--

Caution Ca	aution	Failure to follow the instructions may lead to a minor injury or accident.
------------	--------	--



Warning

 Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss. (e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime/disaster prevention devices, etc.)

Failure to follow this instruction may result in personal injury, fire, or economic loss.

- Do not use this product for protecting human body or part of body.
- Do not see light LED directly or direct beam at person.
 Failure to follow this instruction may result in damage on eyes.
- Do not connect, repair, or inspect the unit while connected to a power source.
 Failure to follow this instruction may result in fire.
- Check connections and connect cables.
 Failure to follow this instruction may result in fire.
- Do not disassemble or modify the unit.
 Failure to follow this instruction may result in fire.



Caution

- Use the unit within the rated specifications.
 Failure to follow this instruction may result in fire or product damage.
- Use dry cloth to clean the unit. Do not use water or organic solvent when cleaning the unit.
 Failure to follow this instruction may result in fire.
- Do not use the unit where flammable/explosive/corrosive gas, humidity, direct sunlight, radiant heat, vibration, impact or salt may be present.
 - Failure to follow this instruction may result in fire or explosion.
- Keep metal chip, dust and wire residue from flowing into the unit.
 Failure to follow this instruction may result in fire or product damage.

The above specifications are subject to change and some models may be discontinued without notice.

Be sure to follow cautions written in the instruction manual, user manual and the technical descriptions (catalog, homepage).

Caution during Use

- Follow instructions in Cautions during Use. Otherwise, it may cause unexpected accidents.
- In case of 24VDC model, power supply should be insulated and limited voltage/current or Class 2, SELV power supply device.
- In order to avoid malfunction from static electricity or noise, ground shield wire of the power I/O cable.
- Do not disconnect the power supply while setting operation or saving set information.
 It may cause data loss.
- Do not disconnect the power supply while updating firmware.
 It may cause product damage.
- Keep optical section of the sensor away from the contact with water, dust and oil. It may cause malfunction.
- When changing the light or filter, use the assembly tool and observe installation instruction.
- When the sensor is not used for a long time, separate the power cable to store.
- When connecting network, connection must be operated by technical expert.
- In the following case, disconnect the power supply immediately. It may cause fire or product damage.
 - ① When water or foreign substance is detected in the product
 - 2 When the product is dropped or case is damaged
 - 3 When smoke or smell is detected from the product
- Do not use the product in the place where strong magnetic field or electric noise is generated.
- This unit may be used in the following environments.
 - ① Indoor (in the environment conditions in specifications)
 - ② Altitude max. 2,000m
 - 3 Pollution degree 2
 - 4 Installation category Π

Caution during Use Autonics

Table of Contents

	Piela	ce		
	User	Manual C	Guide	iv
	User	Manual S	Symbols	V
	Safet	y Conside	erations	vi
	Cauti	on during	g Use	vii
	Table	of Conte	ents	ix
1	Prod	luct Ins	truction	11
	1.1	Featur	es	11
	1.2	Access	sory and sold separately	12
		1.2.1	Overall configuration diagram	12
			Accessory	
			Sold separately	
	1.3		ng Information	
	1.4	Unit D	escription	17
2	Spec	cificatio	ons	19
3	Dime	ensions	S	21
	3.1	Body		21
	3.2	Bracke	et	21
		3.2.1	Bracket A (BK-VG-A)	21
			Bracket B (BK-VG-B)	
	3.3			
			Power I/O cable	
			Ethernet cable	
4			s	
	4.1	Power	I/O Cable (M12 12-pin connector)	24
			Input	
			Output (OUT0 to OUT3)	
	4.2		net Cable (M12 8-pin/RJ45 connector)	
5				
	5.1	Sensin	ng Distance and FOV by Effective Focal Length	28
	5.2		ation of Vision Sensor	
	5.3		Adjustment	
	5.4	Replac	cement of Light and Filter	
		5.4.1	Replacement of color filter or polarizing filter	
			Replacement of light	
6			sor Program [Vision Master]	
	6.1		iew	
	6.2		Master Work Flow	
		6.2.1	Setting mode	36

		6.2.2 Opera	ation mode	37
	6.3	Installation of	f Vision Master	38
			m requirementslation of the program	
			lation folder structure	
			oval of the program	43
		6.3.5 Netwo	ork setting	44
	6.4	Start and Exit	t	46
		6.4.1 Start .		46
		6.4.2 Exit		46
	6.5	Vision Master	r Screen Layout	47
		6.5.1 Menu		49
		6.5.2 Toolba	ar	52
	6.6	Setting Menu	1	54
		6.6.1 Netwo	ork	54
		6.6.2 Came	era	56
		6.6.3 Input.		60
		6.6.4 Outpu	ut	64
			Group	
		6.6.6 Inspe	ction	70
	6.7	Inspection		73
		6.7.1 Alignr	ment	74
		6.7.2 Bright	tness	78
			ast	
		_		
		•	:h	
		_)	
			etert counting	
_		,	_	
7		•		
	7.1			
	7.2	Device (Visio	n Sensor)	100
8	Trou	oleshooting.		105

1 Product Instruction

1.1 Features

VG series, vision sensor, is the light and sensor integrated type which has 9 types of inspection functions, so that it can be applied and utilized for various environment and condition. Before applying to actual environment to utilize, using simulator can realize inspection.

Since it is available to set 32 work groups and 64 inspection items for each work group, vision sensor can flexibly response to the change of work environment.


Furthermore, parameter setting and monitoring from PC is simple through Ethernet communication.

- Light integrated vision sensor
- Minimized image distortion with global shutter method
- Proprietary technology to block optical interference to improve optical performance (patent)
- Stronger in environment of vibration or impact with lens cover detachment prevention technology
- Various inspection function: alignment, brightness, contrast, area, edge, length, angle, diameter, object counting
- Flexible response to changing work environment by setting 32 work groups (64 inspection items for each work group)
- Easy work group managing and parameter setting
 - : Through vision sensor program (Vision Master), it is available to copy or save work group saved in vision sensor to PC or work group saved in PC to vision sensor.
- Real-time monitoring of inspection result
 - : Through vision sensor program (Vision Master), it is available to monitor the Pass/Fail inspection result of inspection items in real-time. Furthermore, statistics data of the inspection result can be generated, and it can be also initialized during inspection.
- Realization of inspection by simulator
 - : Through vision sensor program (Vision Master), it is available to register work group with an image saved in PC to test inspection, without vision sensor.
- Saving data to FTP server
 - : According to the settings, an inspection result image can be transmitted and saved in FTP server. Furthermore, setting the file naming rule can help to manage file.
- Applicable to various environment with various light and filter
 - 4 types of light (white/red/green/blue)
 - 4 types of color filter (red/green/blue/infrared blocking)
 - Polarizing filter (window/red/green/blue/infrared blocking)
- Protection structure IP67 (IEC standard)


Autonics

1.2 Accessory and sold separately

1.2.1 Overall configuration diagram

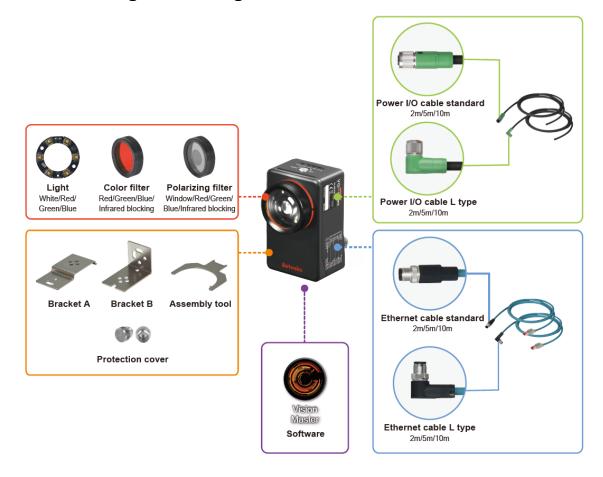

1.2.2 Accessory

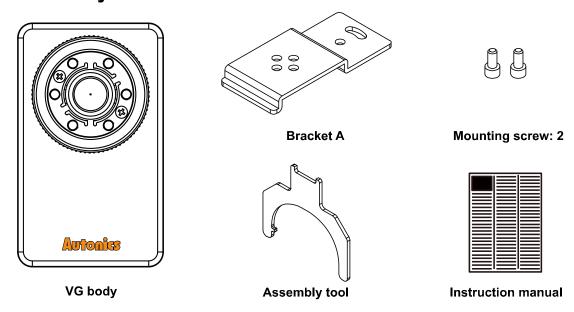



Note

- Visit our homepage (www.autonics.com) to download vision sensor program (Vision Master). Before using the product, please check whether all accessories above are included. If there is a damaged or missing accessory, please contact Autonics sales team or retailer.



Please refer to the model name below, when purchasing the lost accessory.

Assembly tool




Bracket A



1.2.3 Sold separately

■ Light[※]

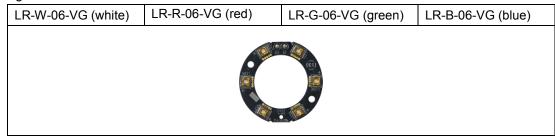

*Besides offered light, another type of lights are sold separately.


Color filter




Polarizing filter



■ Power I/O cable

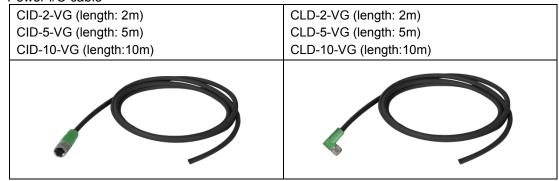


Ethernet cable

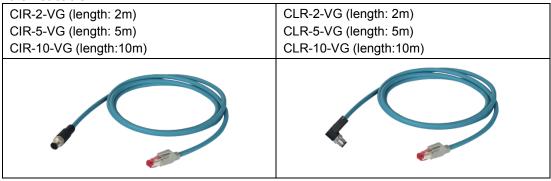

Protection cover^{**}




Bracket B

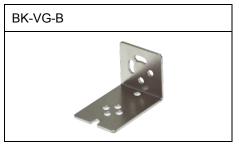

XProtection cover protects unused connectors from foreign substances.

When installing the protection cover, please tighten the cover with hand.

 
1.3 Ordering Information



Items	Descript	Description		
① Item	V	Vision sensor		
② Type	G	General inspection		
③ Image element	М	Mono CMOS		
4 Resolution (pixel)	04	752×480		
	W	White		
@ limbt	R	Red		
⑤ Light	G	Green		
	В	Blue		
	8	8mm		
6 Effective focal length	16	16mm		
	25	25mm		
⑦ Communication	Е	Ethernet (TCP/IP)		

^{※1}. Light can be purchased separately.

1.4 Unit Description

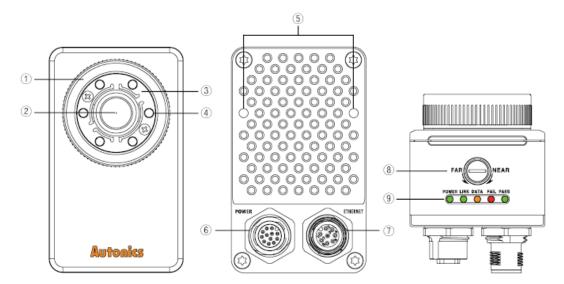

- Lens cover: Front cover of lens
 ※In case using a filter (color filter/polarizing filter), separate the lens cover with the assembly tool before insert the filter.
- 2 Lens: There are 8mm, 16mm, 25mm models by effective focal length.
- 3 Light cover: Light cover fixes inner LED lights.
- 4 Light: Inner LED lights※In order to change the light, separate lens cover and light cover.
- ⑤ Bracket mounting hole on back side: Install the vision master from the back side using bracket B.
- 6 Power I/O connector: Connect the power I/O cable.
- (7) Ethernet connector: Connect the Ethernet cable. It is for TCP/IP communication.
- ® Focus adjuster: After fixing vision sensor, adjust focus by rotating the focus adjuster.
- 9 Indicators

Indicator		Color	Descriptions
POWER	Power indicator	Green LED	Turns ON when power is supplied.
LINK	Ethernet connection indicator	Green LED	Turns ON when vision sensor is connected with PC (Ethernet communication).
DATA	Data transmission indicator	Orange LED	Flashes when data is transmitted from vision sensor to PC.
FAIL	Failure indicator	Red LED	Flashes when detects failure during work group inspection.
PASS	Pass indicator	Green LED	Flashes when passed inspection during work group inspection.

1 Product Instruction Autonics

2 Specifications

Model		VG-M04□-8E	VG-M04□-16E	VG-M04□-25E				
Effective focal length		8mm	16mm	25mm				
Min. sensing distance		50mm	100mm	200mm				
Power sup	pply	24VDC== (±10%)						
Power con	sumption	1A						
	Inspection item	Alignment, brightness, object counting	contrast, area, edge, le	ength, angle, diameter,				
	Work group	32	32					
Inspection	Simultaneous inspection	64						
	Camera frame per second ^{*1}	Max. 60fps						
	Image filter	Preprocessing, externa	al filter (color filter, polar	rizing filter)				
	Image element	1/3 inch mono CMOS						
	Resolution	752×480 pixel						
Image sna	Camera frame per second ^{*1}	Max. 60fps						
	Shutter	Global shutter						
	Exposure time	20 to 10,000us						
Light	ON/OFF method	Pulse						
	Color	White, red, green, blue						
Trigger mo	ode	External trigger, internal trigger, free-run trigger						
	Signal	Rated input 24VDC (±10%)						
Input	Туре	External trigger input (TRIG), encoder input (IN2, IN3), work group change (IN0 to IN3)						
	Signal	NPN or PNP open collector output Max. 24VDC== 50mA, residual voltage: max. 1.2VDC==						
Output	Туре	Control output (OUT0 to OUT3) : inspection completion, inspection result, external light trigger, alarm, camera busy						
	FTP transmission	Possible						
Communic	cation	Ethernet(TCP/IP), 100BASE-TX/10BASE-T						
Protection	circuit	Output short over current protection circuit						
Indicator		Power indicator (POWER), Ethernet connection indicator (LINK), pass indicator (PASS): green LED						
aioatoi		Data transmission indicator (DATA): orange LED						
		Failure indicator (FAIL): red LED						
Insulation	resistance	Over 20MΩ (at 500VDC megger)						
Dielectric s	strength	500VAC 50/60Hz for 1	min					

Model		VG-M04□-8E	VG-M04□-16E	VG-M04□-25E	
Vibration		1.5mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 2 hours			
Shock		300m/s ² (approx. 30G)) in each X, Y, Z directio	n for 3 times	
Environ	Ambient temp.	0 to 45°C, storage: -20	to 70°C		
ment	Ambient humi.	35 to 85%RH, storage: 35 to 85%RH			
Protection structure		IP67 (IEC standard)			
Material		Case: aluminum, lens cover/focus adjuster: polycarbonate, cable: polyurethane			
Accessor	ies	Assembly tool, bracket A, mounting screw: 2			
Sold separately		Light, color filter, polarizing filter, power I/O cable, Ethernet cable, bracket B, protection cover			
Approval		(€, №			
Weight ^{∞2}		Approx. 415g (approx. 273g)	Approx. 416g (approx. 274g)	Approx. 416g (approx. 274g)	

 $[\]times$ 1. The number of camera frames per second can be different by image setting or inspection item.

^{%2}. The weight includes packaging. The weight in parenthesis is for unit only.


XEnvironment resistance is rated at no freezing or condensation.

Autonics 3 Dimensions

3 Dimensions

3.1 **Body**

(unit: mm)

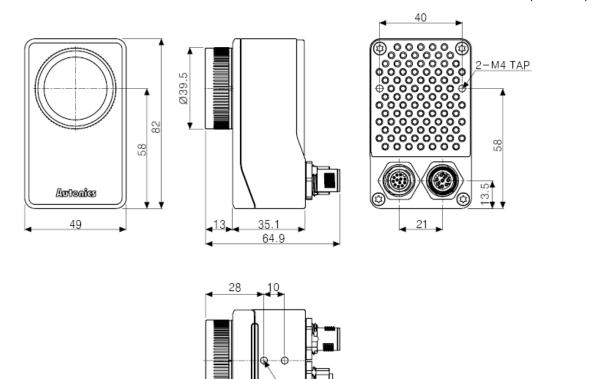


2-M4 TAP

3.2 Bracket

3.2.1 Bracket A (BK-VG-A)

2-R2.1 R10 40° 5-Ø4.2 7,5 10 10

3.2.2 Bracket B (BK-VG-B)

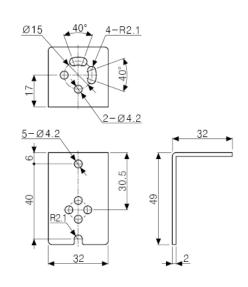


3.3 Cable


(unit: mm)

3.3.1 Power I/O cable

 (1) CID Series



 
(2) CLD Series




XL(m): 2m, 5m, 10mPlease refer to the cable length.

3.3.2 Ethernet cable

 (1) CIR Series




 (2) CLR Series



X L(m): 2m, 5m, 10m
Please refer to the cable length.

4 Connections

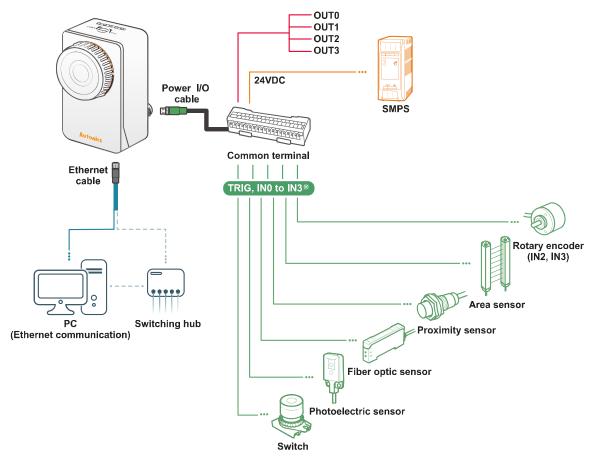


When selecting a product, please refer to Autonics selection guide.

4.1 Power I/O Cable (M12 12-pin connector)


Pin arrangement	Pin No.	Cable color	Signal	Function	
	1	Brown	24VDC	24VDC	
	2	Blue	GND	GND	
	3	White	TRIG	Trigger input	
	4	Green	IN0	Work group change Bit 0	Work group change - Clock
	5	Pink	IN1	Work group change Bit 1	Work group change - Data
9 10 3 8 12 11 4	6	Yellow	IN2	Work group change Bit 2	Encoder - Up counter - Quadrature A
765	8	Gray	IN3	Work group change Bit 3	Encoder - Down counter - Quadrature B
	11	Gray/Pink	COMMON	COMMON	
	7	Black	OUT0	Inspection completion, inspection result, external light trigger, alarm, camera busy	
	9	Red	OUT1		
	10	Purple	OUT2		
	12	Red/Blue	OUT3		

4.1.1 Input

(1) External trigger input (TRIG), Work group change input (IN0 to IN3)

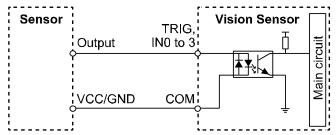


(2) Encoder input (IN2, IN3)

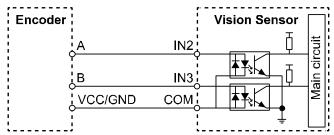


4.1.2 Output (OUT0 to OUT3)

(1) NPN open collector output

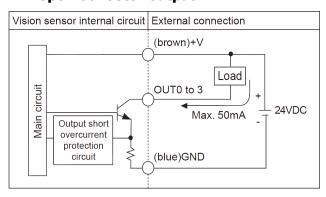


(2) PNP open collector output

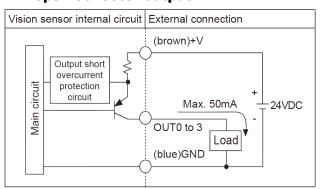

4.2 Ethernet Cable (M12 8-pin/RJ45 connector)


Din arrangement	M12 8-pin		Cable color	RJ45	
Pin arrangement	Pin No.	Signal	Cable Color	Pin No.	Signal
	6	RX+	White/Orange	1	TX+
	4	RX-	Orange	2	TX-
2001	5	TX+	White/Green	3	RX+
3 8 9	8	TX-	Green	6	RX-
	1	-	White/Blue	5	-
5 6	7	-	Blue	4	-
	2	-	White/Brown	7	-
	3	-	Brown	8	-

5 Installation

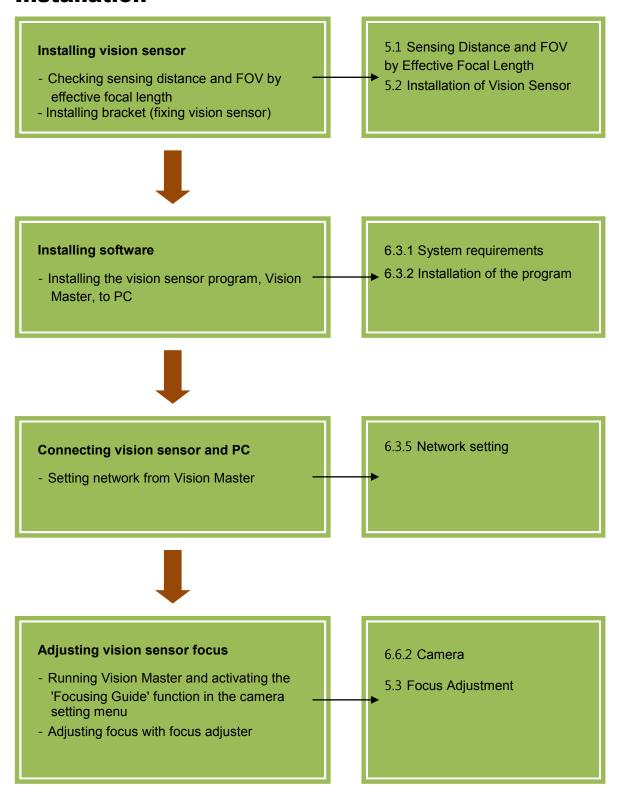


5.1 Sensing Distance and FOV by Effective Focal Length

Please check sensing distance by effective focal length and FOV (Field of View).

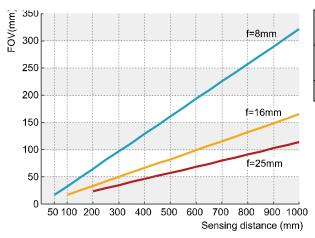

Effective focal length(f)	8mm	16mm	25mm
Min. sensing distance	50mm	100mm	200mm
Brightness	F2.0	F2.5	F2.5

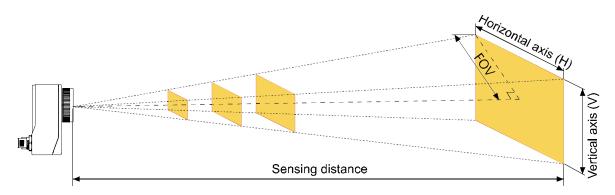


X Sensing distance by effective focal length (unit: mm)

Effective focal length	Sensing distance	50	100	200	300	400	500	600	700	800	900	1,000
8mm	FOV	16	32	64	96	129	161	193	255	257	289	322
	Horizontal axis (H)	27	54	108	163	217	271	325	380	434	488	542
	Vertical axis (V)	17	35	69	104	138	173	208	242	277	311	346
16mm	FOV	_	16	33	49	66	82	99	155	132	148	165
	Horizontal axis (H)	_	28	56	83	111	139	167	195	222	250	278
	Vertical axis (V)	_	18	35	53	71	89	106	124	142	160	177
25mm	FOV	_	_	23	34	46	57	68	80	91	103	114
	Horizontal axis (H)	_	_	38	58	77	96	115	134	154	173	192
	Vertical axis (V)	_	_	25	37	49	61	74	86	98	110	123

5.2 Installation of Vision Sensor


1st Fix vision sensor using bracket.

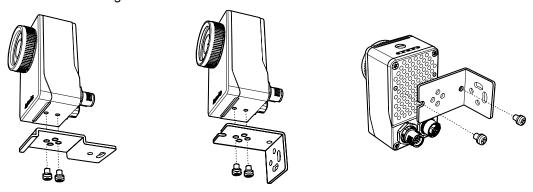

<Install vertically from the bottom>
-bracket B


<Install vertically from the back side>
-bracket B

2nd Place the sensing target at the center of the vision sensor lens.

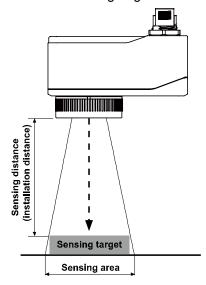

5.3 Focus Adjustment

After installing and running Vision Master, use the focusing guide function to adjust the focus. Using (-) screwdriver, turn focus adjuster to right and left to adjust the focus.

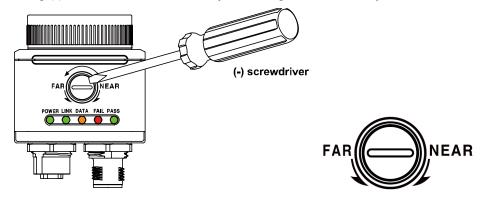


- X Please refer to '6.3 Installation of Vision Master' for the installation of Vision Master and network setting.
- X Please refer to '6.6.2 Camera (7) Focusing guide ' for the focusing guide.


5.4 Replacement of Light and Filter

5.4.1 Replacement of color filter or polarizing filter

1st Put and fix the assembly tool into the groove on the side of the vision sensor.

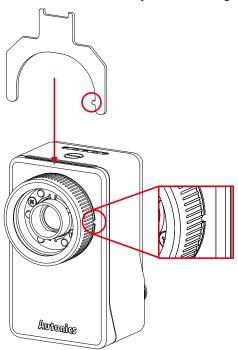


2nd While fixing the vision sensor with the assembly tool, hold the lens cover and disassemble it in a counter clock wise direction.

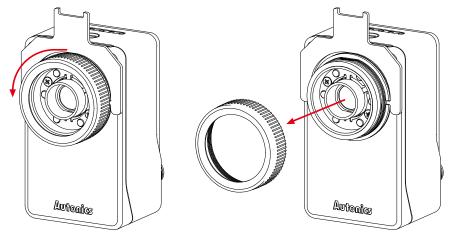


3rd Instead of the disassembled lens cover, assemble another color filter or polarizing filter in clock wise direction.


5.4.2 Replacement of light

- 1st Put and fix the assembly tool into the groove on the side of the vision sensor.
- 2nd While fixing the vision sensor with the assembly tool, hold the lens cover and disassemble it in a counter clock wise direction.
- 3rd Disassemble the light cover using the (+) screwdriver, and disassemble the inner LED light.

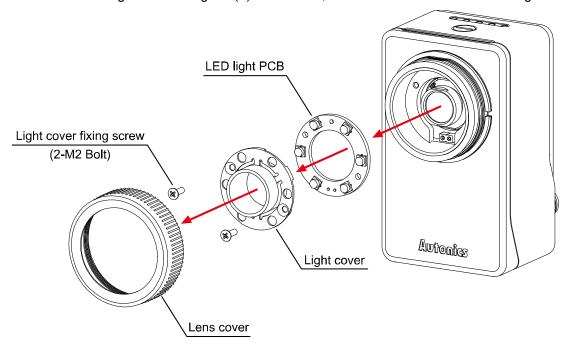


4th Place the connection pin of PCB of the inner LED light to face the direction of 6 o'clock and assemble it to the vision sensor body.

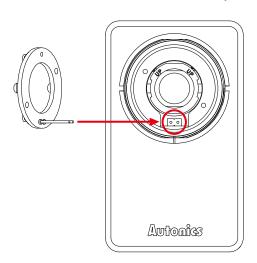

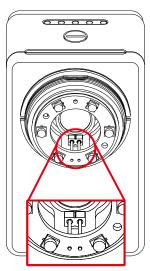

Autonics

5th Align the light cover with the groove in the direction of 12o'clock and fix it with the screw. Tighten them with the 1.2kgf·cm of tightening torque.

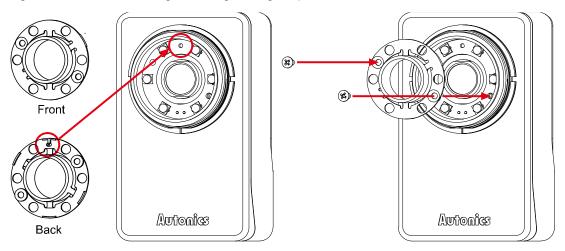

6th Assemble the disassembled lens cover in clock wise ditection.


6 Vision Sensor Program [Vision Master]

6.1 **Overview**

Vision Master is the vision sensor program that is connected with VG Series, Autonics vision sensor, to utilize it.

Vision Master provides graphic user interface to make setting parameter and managing monitoring data of vision sensor easy.

It is connected with vision sensor through Ethernet (TCP/IP) and exchange data with vision sensor.

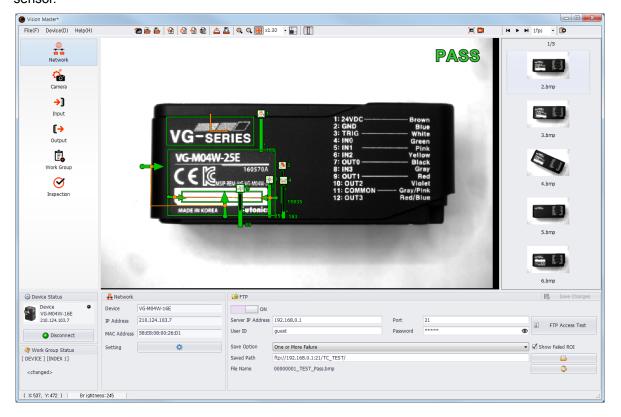


Item	Description							
	Compares features of the registered image and input image to search for a similar pattern position, and inspects the input image with information of the searched pattern position and rotation angle.							
	<template></template>	<pass></pass>	<fail></fail>					
Alignment	VO TIGITAL	VG-THIRE TO THE THIRD THE						
	Inspects brightness of ROI of the input image based on the brightness average value of ROI (Region of Interest) of the registered image.							
Brightness	<template></template>	<pass></pass>	<fail></fail>					
	Inspects contrast of the input image ROI based on contrast of the registered image ROI.							
	<template></template>	<pass></pass>	<fail></fail>					
Contrast	Autonics	ssinotuA	Autonics					
	Inspects the ROI area of the input image based on the ROI area of the image registered by the user.							
	<template></template>	<pass></pass>	<fail></fail>					
Area	[Sid	US1 BOOM						
	Inspects the direction of the edge in the input image based on the edge registered by the user in the same area.							
. Edge	<template> DISPOSABLE FA ALIBOHOL SWI</template>	Pass> TO A A S SMS TOMOGIN & STEPS A SIGNED SMS TOMOGIN & STEPS	<fail> OLONG STORY S</fail>					


Item	Description							
	Inspects the input image based on the length between two edges registered by the user.							
→ Length	<template></template>	<pass></pass>	<fail></fail>					
	Inspects the input image based on the angle between two edges registered by the user.							
Angle	<template></template>	<pass></pass>	<fail></fail>					
	Inspects the input image based on the area between two circles registered by the user.							
Diameter	<template></template>	<pass></pass>	<fail></fail>					
	Compares the number of object in the input image and the number of object in ROI of the image registered by the user.							
Object counting	<template></template>	<pass></pass>	<fail></fail>					

6.2 Vision Master Work Flow

6.2.1 Setting mode

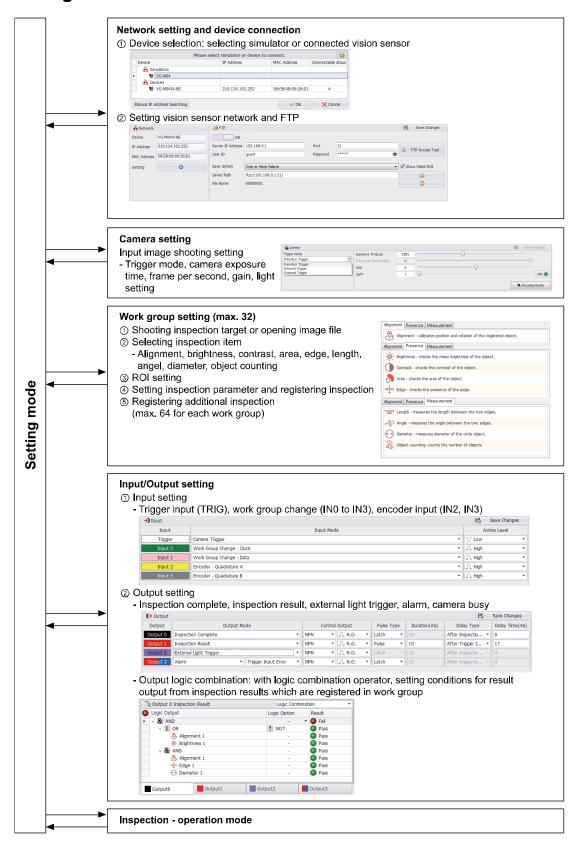

6.2.2 Operation mode

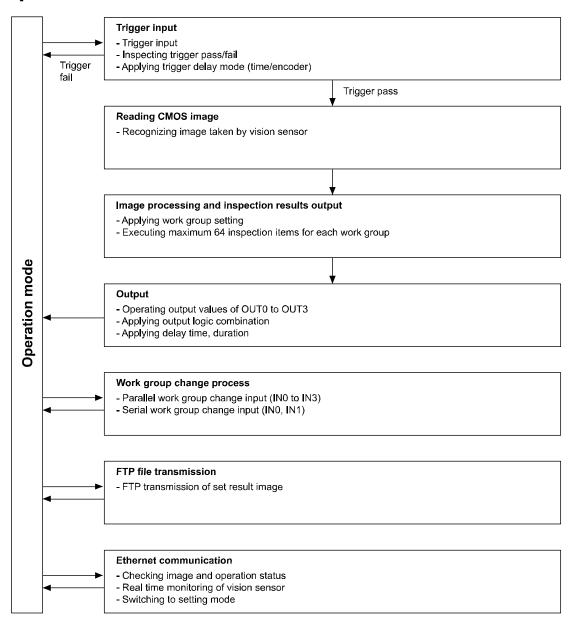

6.3 Installation of Vision Master

6.3.1 System requirements

Item	Minimum specifications
System	32bit (×86) or 64bit (×64) processor over 1GHz
Operations	Microsoft Windows 7/8/10
Memory	1GB+
Hard disk	400MB+ of available hard disk space
VGA	Resolution: 1024×768 or higher
Others	RJ45 Ethernet port

6.3.2 Installation of the program

- 1st Download Vision Master program at Autonics web page(<u>www.autonics.com</u>).
- 2nd Close all programs before you start Vision Master installation.

 Double-click Vision Master setup.exe to start installation.
- 3rd When Installer Language window appears, select the language and click [OK] button. Supporting language is Korean, English and Simplified Chinese.






Vision Master 1.0.6.27 Setup Welcome to Vision Master 1.0.6.27 Setup **Sensors & Controllers** Setup will guide you through the installation of Vision Master It is recommended that you close all other applications before starting Setup. This will make it possible to update relevant system files without having to reboot your computer. Click Next to continue. Next > Cancel

4th Click [Next] button in the installation welcome window.

5th This process is license agreement.

You can check whole part of license agreement article by rolling mouse scroll downward, clicking downward arrow or press "Page Down(PgDn)" Key of the keyboard. Please read the articles thoroughly before click [I Agree] button.

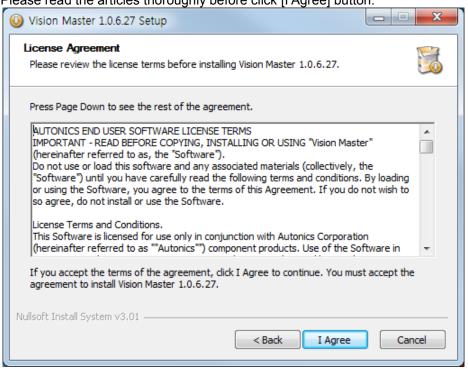

6th Choose Install Location window appears.


Default installation path is as follows.

C:\Program Files (x86)\Autonics\Vision Master\

Click [OK] button to install the program in the default installation path. - - X Vision Master 1.0.6.27 Setup Choose Install Location Choose the folder in which to install Vision Master 1.0.6.27. Setup will install Vision Master 1.0.6.27 in the following folder. To install in a different folder, click Browse and select another folder. Click Install to start the installation. Destination Folder C:₩Program Files (x86)₩Autonics₩Vision Master Browse... Space required: 120.7MB Space available: 55.0GB Nullsoft Install System v3.01 -< Back Install Cancel

7th Click [Install] button to install the program in the default installation path.

If you want to install the program in another installation path, click [Browse..] button to designate a folder you want to install in and click [OK] button.

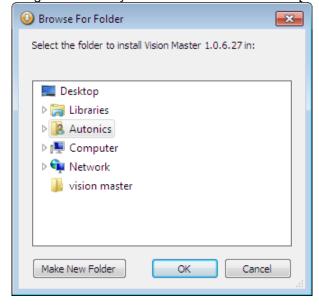

Vision Master 1.0.6.27 Setup

Installing
Please wait while Vision Master 1.0.6.27 is being installed.

Created uninstaller: C:\(\pi\)Program Files (x86)\(\pi\)Autonics\(\pi\)Vision Master\(\pi\)uninstall.exe

Show details

Nullsoft Install System v3.01


< Back Next > Cancel


8th Installation progress is displayed in the status window as follows.

9th Installation Complete window appears after installation is completed.

If the check box in the Installation Complete window is checked, Vision Master runs upon completion of installation.

You can run Vision Master by double-clicking the Vision Master icon on the desktop.

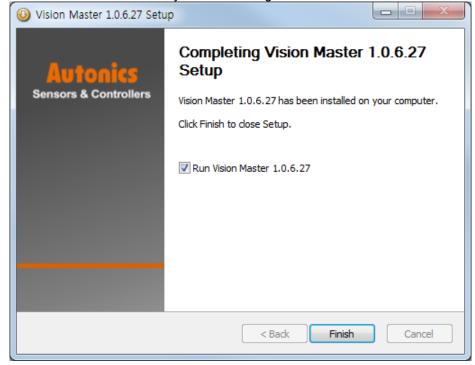

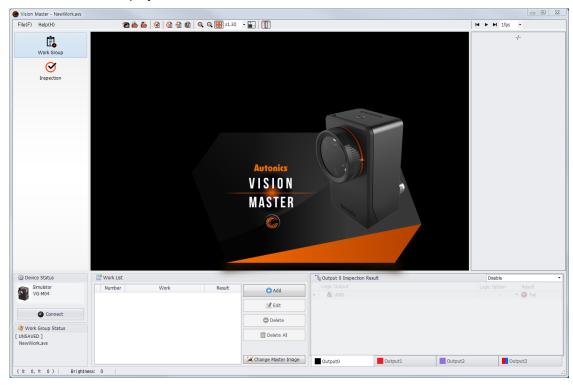


The initial screen displays as follows.

6.3.3 Installation folder structure

This section explains the folder structure created when you installed Vision Master.

The Vision Master folder is created in [C:\Program Files (x86)\Autonics\] as a subfolder unless you select a new destination to change location of Vision Master folder.

After Vision Master is installed completely, Vision Master installation folder and related folders are created as follows in [C:\Users\(Account name)\Documents\Autonics\)] as subfolders and work groups and documents are saved in. The program and all relevant documents are stored in these folders.

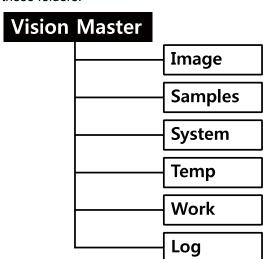

(1) Image folder

If Save Result Image inspection parameter of Vision Master is set to ON, inspection result images are saved in the designated location. Saving location is fixed, so that is cannot be changed by user.

Inspection result images are saved in [C:\Users\(Account name)\Documents\Autonics\Vision Master\Image\ResultImage].

(2) Sample folder

This folder contains work groups for samples. Load sample files from this folder to Vision Master to test inspection.

(3) Work folder

When saving work groups from Vision Master to PC, the work groups are saved in this folder. When copying work groups from a device to PC using work group manager, the work groups are saved in this folder.

If the saving location is changed when saving work groups in PC, work groups are saved in the changed folder.

(4) Log folder

Log files of connection/disconnection with a device or inspection result are saved.

6.3.4 Removal of the program


There are procedures to uninstall Vision Master, Start > Program > Vision Master > Uninstall or Start > Setting > Control Panel > Add/Remove a Program > Vision Master.

When a confirmation window appears after selecting Remove, click [Yes] button to remove Vision Master from the computer.

6.3.5 Network setting

Change the network settings in Vision Master to connect with a device (vision sensor).

When executing Vision Master, Select Device window appears. Simulator or connected devices are displayed in the window. You can check connectable devices and connected devices using Refresh icon () on the top of the window.

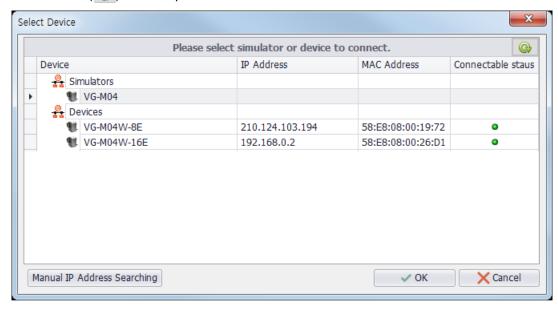


Factory default of the device (vision sensor) is as follows.

IP address	192.168.0.2
Subnet mask	255.255.255.0
Gateway	192.168.0.1



A list of the currently connected vision sensor is displayed. Check "connectable status" indicator to figure out which vision sensor is connectable.


- : Connectable
- : Unconnectable
 - The vision sensor is not connectable because it is connected to another PC already.

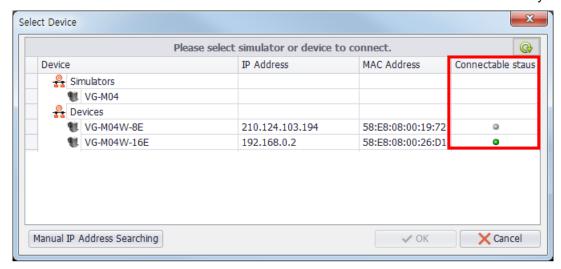


(1) Change of device IP address

If IP address of the device to use and PC are on a different band, double click IP address and change the network settings.


1st Double click IP address of the device to connect.

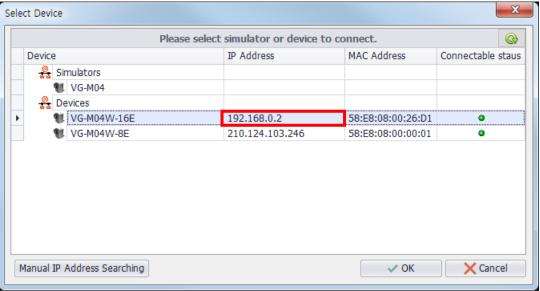

2nd Click [OK] button.

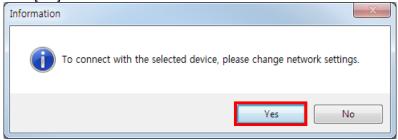

3rd Change IP address in Change Network Setting window.

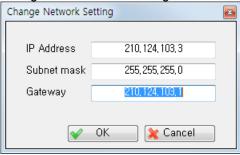




Caution

If changed IP address is same with another IP address which is used in another PC of device, network error can occurs due to IP address conflicts.

(2) Manual search of IP address

 If a device is not recognized while it is connected, click "Manual IP Address Searching" and search IP address of the device to connect.




6.4 Start and Exit

6.4.1 Start


Double-click Vision Master icon in the desktop or select Start > Program > Vision Master to start the program.

6.4.2 Exit


Click [X] button on the top right corner of the screen or 'exit' in the file menu to end the program.

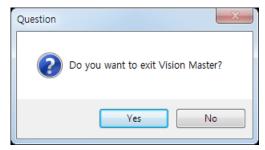

Since work group, parameter settings, and data are not saved automatically, please make sure that you have saved the work group before you exit.

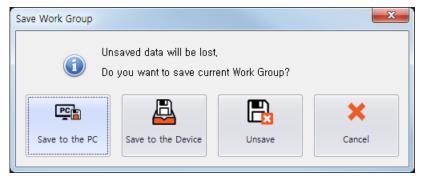

6.5 Vision Master Screen Layout

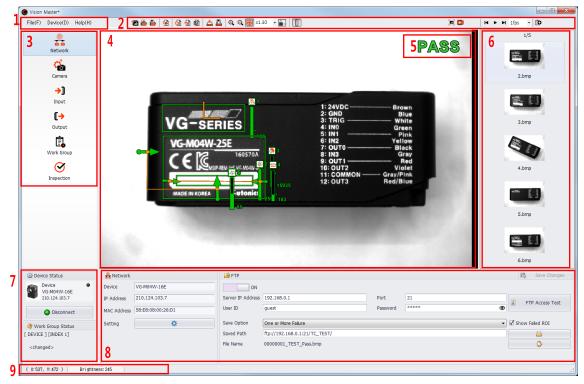


The program screen is divided into sections as shown in the preceding screenshot and each section is composed of the following items.


No.	Item	Description
1	Menu	Displays Vision Master menus by category.
2	Tool bar	Displays icons of frequently used menu, settings of image window, camera snap, or etc.
	Setting	Displays vision sensor setting parameter menu. If none of device of connected, it is available to connect simulator to register work group and inspection test. Activation of the setting menu depends on the type of the connected device
3	menu	(simulator or device)
		- Simulator connection: work group, inspection
		- Device (vision sensor) connection: network, camera, input, output, work group, inspection
		Displayed image is different according to the mode and settings.
4	Image window	- Setting mode: displays a taken image by vision sensor or selected image between master image to register work group and loaded image to preview window.
		- Operation mode: displays taken images according to the "View Result Image" settings. Please refer to '6.6.6 Inspection'.
5	Inspection result	Displays inspection result (Pass/Fail) of work group.

No.	Item	Description
		Displays loaded images.
6	Preview window	If the 'Add Taken Image to Preview Window' icon (is activated, preview window displays images taken by the vision sensor, which are different according to the mode and settings. - Setting mode: displays all images taken by the vision sensor. - Operation mode: while inspecting, displays taken images according to the 'View Result Image' settings. Please refer to '6.6.6 Inspection'. Right click in the preview window to display setting menu as follows. Load Image File
7	Status information	Displays status information of the device and work group. - Device status : displays information of simulator or device (vision sensor) connected to Vision Master. It is available to connect or disconnect device. Indicator on the top right side enables to check the communication status between Vision Master and the device, when the device is connected. The indicator flashes while data communication. Device Status
		[UNSAVED] [DEVICE] [INDEX 1] [PC] NewWork.avs
8	Parameter	Displays specific parameters in the setting menu.
9	Image information	Displays brightness value and pixel coordinate of the point where the mouse cursor is pointing on the image window.

 
6.5.1 Menu



(1) File

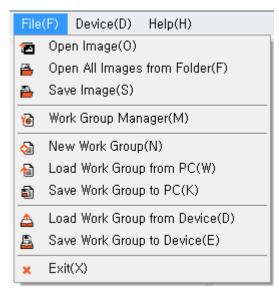

 - Open Image: Opens the image to inspect.
- Open All Images from Folder: Opens the folder of images to inspect.
- Save Image: Saves the image displayed in Image window.
- Work Group Manager: Displays a list of work group saved in the PC or device to copy, delete, or save. It is available to set work group to use when the device turns on.




No.	Icon	
1	×	Deletes selected work group.
2		Selects a folder in the PC to load work group from.
3	•	Copies work group from the device to the PC.
4	•	Copies work group from the PC to the device.
5	~	Selects work group to operate when the device turns on.


- New Work Group: Registers new work group.
- Load Work Group from PC: Loads work group from the local disk of PC.
 Work groups are saved in the default folder [C:\Users\ (Account name)
 \Documents\Autonics\Vision Master\Work] or the folder designated by user.
- Save Work Group to PC: Saves work groups registered and set in Vision Master to the local disk of PC.

Work groups are saved in the default folder [C:\Users\ (Account name) \Documents\Autonics\Vision Master\Work] or the folder designated by user.

• Load Work Group from Device: Loads work group from the device (vision sensor).

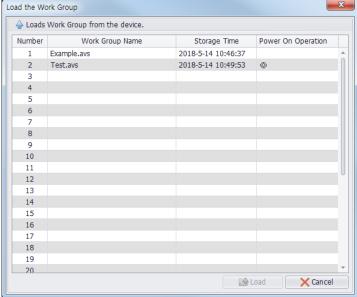

 Save Work Group to Device: Saves work groups registered and set in Vision Master to the device (vision sensor). Click number of work group to save to set the name of work group. At that moment, selected work group can be set as operating work group when the device turns on. Work group can be registered and saved up to 32.

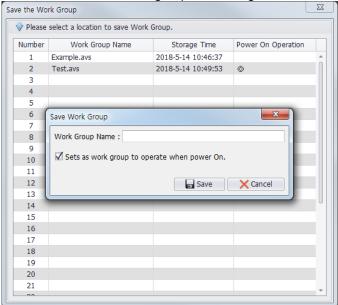


Exit: Exits Vision Master.

(2) Device




■ I/O Test: Displays input status with the indicators (no input: ② / input: ②). Also it is available to set control output type (NPN/PNP) and whether use each output or not. I/O test is only for testing output, so that it is not associated with settings of output parameter

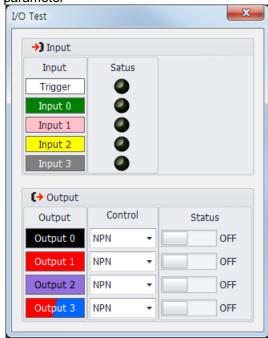

- Firmware Update: Updates firmware version of the device (vision sensor).
- Device reset: Resets the device, deleting saved work group and set parameters from the device.

(3) Help

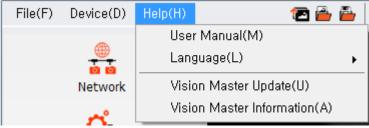

- User Manual: Loads user manual.
- Language: Changes program language to Korean, English, or Simplified Chinese.
- Vision Master Update: Updates version of Vision Master.
- Vision Master Information: Displays information about version of Vision Master and device firmware.

6.5.2 Toolbar



Section	Icon		Description				
	1	Open Image					
1		Open All Images from Folder					
		Save Image					
2		Work Group Manager					
		New Work Group	Please refer to '(1) File' in '6.5.1 Menu'.				
3		Open Work Group from PC					
		Save Work Group to PC					
4 *1		Open Work Group from Device					
4***		Save Work Group to Device					
	•	Zoom in	Enlarges image.				
		Zoom out	Reduces image.				
	* * *	Fit to Window	Adjusts the size of the image to fit to the image window.				
5	x1.31 -	Image Scale	Resize image Setting range: ×0.5, ×1, ×2, ×4, ×8, ×16				
	↑	Full Screen	Displays image in full screen mode. To turn off full screen view, press ESC key or double click mouse button.				
6		Show Bar Gauge	Displays the pass range of inspection which set in work group as bar gauge.				
		Snap	Takes an image with the camera of vision sensor.				
7 *1, *2		Continuous Snap	Takes multiple images with the camera of vision sensor, according to the set number of frame per second (fps).				
	I◀	Backward	Loads previous image from images in preview window.				
8	>	Play	Loads images consecutively from images in preview window.				


Section	Icon		Description					
		Forward	Loads next image from images in preview window.					
			Selects the image playing speed for displaying images from					
	1fps →	Image Play Speed	preview window.					
			- Setting range: 4fps, 2fps, 1fps, 1/2fps, 1/4fps					
		Pause	Pauses playing of images from preview window.					
9*1		Add Taken Image	Adds taken images to preview windows.					
9		to Preview Window	Adds taken images to preview windows.					

^{%1.} It is not displayed in simulator operation.

 $[\]times$ 2. It is displayed only when the camera trigger mode is set to 'free-run trigger' or 'internal trigger'.


6.6 Setting Menu

 6.6.1 Network






(1) Network

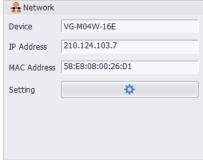


It is available to set vision sensor and PC network.

- Device: Displays currently connected vision sensor to Vision Master.
- IP / MAC Address: Displays IP / MAC address of the connected device.
- Setting: Changes IP address setting of the currently connected device.
 [Current Network Setting] is network information of the currently connected device. To change network setting, enter new information in [New Network Setting].

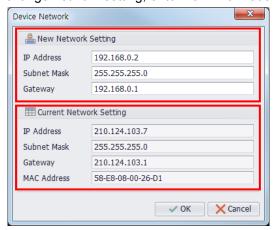

OFF

(2) FTP

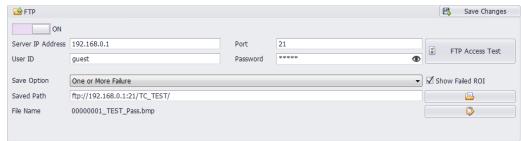


Transmits inspection result images saved in vision sensor memory to FTP server.

Select whether to use FTP function or not. (ON /

- Server IP Address / Port: Enter IP address and port of FTP server.
- User ID / Password: Enter user ID and password.
 ※If Show Password icon () is clicked, being entered password is displayed in characters, not '* '.
- FTP Access Test: Checks status of connection to FTP server.
- Save Option: Sets conditions for saving images.
 - All Pass: Only saves images which pass all the inspection items in work group.
 - One or More Failure: Saves images which failed to pass one or more among inspection items in work group.
 - XIf Show Failed ROI check box is checked, ROI which failed to pass inspection is marked in the result image.
- Saved Path: Enter location in server to save the result image.

 ※When designating folder to upload, click 'Upload Folder Path' icon () on the right side. You can see the list of folder in the server.
- File Name: Sets file name of image to transmit to the FTP server. Click 'Image File Naming Rule' icon () on the right side to set name.

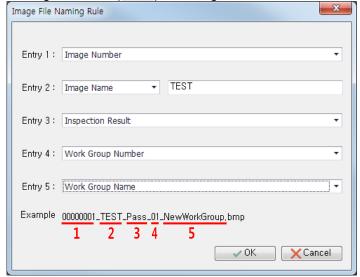


Item can be set up to 5, and you can customize the order of the items.


- Image Number: It is number of taken image. It is necessary for image file naming.
- Image Name: User can set image name using only Korean, English alphabet, number, and some of special characters (except " < > ? * / \ |)
- Inspection Result: Displays inspection result of Pass/Fail.
- Work Group Number / Work Group Name: Displays number and name of inspecting work group.

 6.6.2 **Camera**






 (1) Trigger mode



- Free-Run trigger: Takes images with the maximum trigger speed that can occur in the sensor. (fixed to 60fps)
- Internal Trigger: Takes image by occurring trigger in the sensor (1 to 60fps)
- External Trigger: Takes image with external input signal as trigger. If you use external trigger mode, you can use trigger delay mode.

(2) Trigger Delay Mode

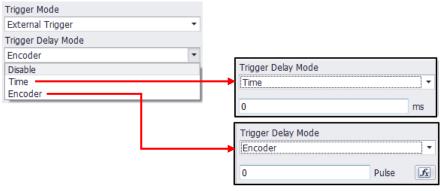


Trigger delay means delayed time from inputting moment of external trigger to actual starting moment of image taking.

- Disable: Do not use the trigger delay.
- Time: Sets the trigger delay in time unit. Setting range is from 0 to 60,000ms.
- Encoder: Sets the trigger delay in unit of the number of pulse. Setting range is from 0 to 16,000,000 pulses.



After setting the trigger delay mode, timing diagram of trigger input is shown as follows.

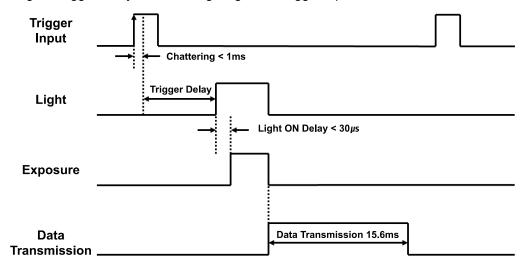

(3) Exposure time

Exposure time is the time span for which the vision sensor is exposed to the light.

The longer exposure time is, the brighter the taken image is, and the shorter exposure time is, the darker the taken image is.

Setting range is from 20 to 10,000us.



(4) Frame per second

Frame per second is Frame rate which is the number of images taken per 1 second. It is settable only when the trigger mode is set to "internal trigger". Setting range is from 1 to 60fps.

XIn the external trigger mode, the vision sensor takes images with external input signal, so that you cannot set the frame per second.


*In the free-run trigger mode, the vision sensor takes images at the fastest speed which the vision sensor can.

(The shorter exposure time is, the faster the vision sensor can take.)

(5) Gain

It is adjusting gain of CMOS image sensor.

As higher gain level makes image brighter, increased noises makes resolution low. Setting range is from the level 1 to 16.

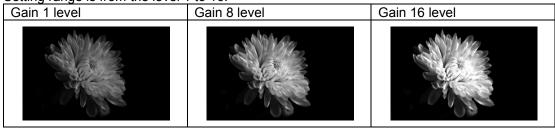

(6) Light

You can set whether to use inner LED light or not. (Use: ON O /not use: OFF O)
Light is synchronized with trigger signal and exposure time.
Setting range is from the level 1 to 16.



(7) Focusing guide

Focusing guide makes adjusting image focus with the focus adjuster convenient. After setting ROI of the sensing target and checking the focusing guide value, rotate the focus adjuster to the point where the focusing guide value is the highest and fix it at the point to use.



How to adjust focus with focusing guide.

1st Click focusing guide button.

Focusing guide ON(Focusing Guide) /OFF (Focusing Guide)

2nd In the image window, the focusing guide value and area is displayed on the master image. Adjust the area to focus on. The higher the focusing guide value is, the clearer focus on the image is.





- 3rd Click continuous snap () on the toolbar on the top.
- 4th Checking consecutively taken images, rotate the focus adjuster to the FAR or NEAR direction. Since initial setting is unknown, rotate the focus adjuster to both FAR and NEAR directions and fix the adjuster at the point where the focusing guide value is the highest.



When sensing target is in near	Focus adjusting is finished.	When sensing object is far
→ rotate to the NEAR direction.		→ rotate to the FAR direction.
50	(1 26	84
	-87	
Autonies	Autonics	Autonics
STATISTICS	SENSORS & CONTROLLERS	SENSORS & CONTROLLERS

  6.6.3 Input





(1) Input mode

- Trigger input (TRIG): The selected trigger mode which set in the camera menu is the image taking signal.
- Work group change (IN0 to IN3)
 - Serial input (IN0, IN1): Input 0 and input 1 are set to work group change Clock or work group change Data, and work group is changed according to the serial input.
 - Parallel input (IN0 to IN3): From input 0 to input 3 are set to each of work group change bit 0 to 3, and work group is changed according to the parallel input.
- Encoder input (IN2, IN3): After input of trigger signal, the vision sensor takes image
 after waiting for a while according to the number of encoder pulse. The types of
 encoder input consist of Up counter/Down counter, and Quadrature. Encoder input is
 used for the trigger delay mode. Maximum 100kHz input can be recognized.


(2) Active level

According to the active level, trigger is applied at High or Low. To avoid chattering of trigger signal, the vision sensor starts taking an image when the signal is maintained for 1ms.

6.6.3.1 Input mode

Input	Signal	Function	
0	IN0	Work group change Bit 0	Work group change - Clock
1	IN1	Work group change Bit 1	Work group change - Data
2	IN2	Work group change Bit 2	Encoder - Up counter - Quadrature A
3	IN3	Work group change Bit 3	Encoder - Down counter - Quadrature B

 (1) Work group change - parallel input (IN0 to IN3)



According to the parallel input, work group is changed.

With parallel input, work group from 1 to 16 can be changed to.

(Following table is based on the High active level.)

Input Work group	Bit 3 (IN3)	Bit 2(IN2)	Bit 1(IN1)	Bit 0(IN0)
Work group 1	Low	Low	Low	Low
Work group 2	Low	Low	Low	High
Work group 3	Low	Low	High	Low
Work group 4	Low	Low	High	High
Work group 5	Low	High	Low	Low
Work group 6	Low	High	Low	High
Work group 7	Low	High	High	Low
Work group 8	Low	High	High	High
Work group 16	High	High	High	High

(2) Work group change - serial input (INO, IN1)




According to the serial input, work group is changed.

Although data is 8-bit, 5 less significant bits are used, because the maximum number of work group is 32.

With serial input, work group from 1 to 32 can be changed to.


Input								
	Bit 0	Bit 1	Bit 2	Bit 3	Bit 4	Bit 5	Bit 6	Bit 7
Work group								
Work group 1	0	0	0	0	0	0	0	0
Work group 2	1	0	0	0	0	0	0	0
Work group 3	0	1	0	0	0	0	0	0
Work group 4	1	1	0	0	0	0	0	0
Work group 5	0	0	1	0	0	0	0	0
Work group 32	1	1	1	1	1	0	0	0

 

- Start bit: Start bit holds the data signal at Low (Falling edge) for 20ms.
- Clock bit: Clock bit is pulse of 20ms interval which acquires data at the Rising edge.
- Data bit: Data bit is synchronized with Falling edge of the clock signal and holds Low or High for 20ms.
- End bit: After 8th data, end bit holds the data signal for 20ms.



When changing work group of the vision sensor to work group 6 with the serial input signal, input the data signal as follows.

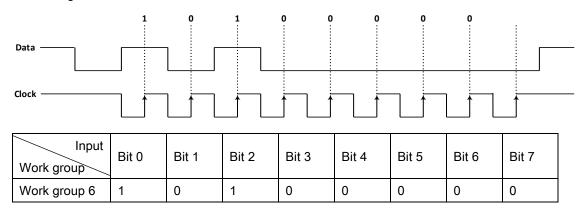


(3) Encoder input


You can use encoder input when you want to use the trigger delay mode of external trigger input on encoder pulse.

Camera trigger occurs after calculating moving distance according to the number of input pulse.

 
Up counter/Down counter (IN2, IN3)



 
Input 2 and input 3 are used as each of encoder input up counter and down counter. The number of pulse is counted up or down according to the active level. If you use only one encoder input, connect unusing input terminal to COMMON. Rising edge is counted in the high active level, and falling edge is counted in the low active level.



 
Encoder input - Quadrature A/Quadrature B (IN2, IN3)



 Input 2 and input 3 are operated in encoder Quadrature. Both rising edge and falling edge of two encoders are counted.




 6.6.4 **Output**




Output		Output Mode				Control	Output		Pulse Type	Duration(ms)	Delay Type	Delay Time(ms)
Output 0	Disable	•		+	NPN	+	√L N.O.	*	Latch +	10	After Inspectio *	0
Output 1	Insepction Result			+	NPN	+	JL N.O.	*	Pulse ▼	10	After Trigger I ▼	17
Output 2	Inspection Complete			+	NPN	+	JL N.O.	*	Pulse +	10	After Inspectio ▼	0
Output 3	Alarm	-	FTP File Transmission Error	*	NPN	*	JL N.O.	-	Latch ▼	10	After Inspectio	0


(1) Output mode

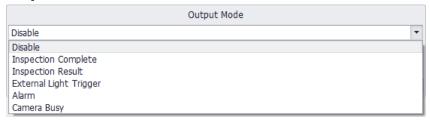

- Inspection Complete: Regardless of the inspection result, the vision sensor outputs output signal at the moment of inspection completion.
- Inspection Result: According to the settings of Output Inspection Result Selection, the vision sensor outputs output signal. Please refer to '6.6.5 Work Group'.

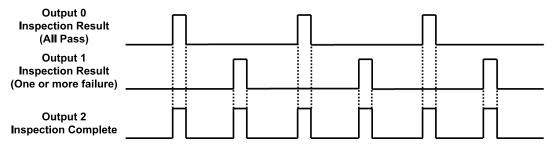

 External light trigger: When connected with the external light, power of the external light is turned ON/OFF with output signal from the vision sensor which is synchronized with camera trigger input.

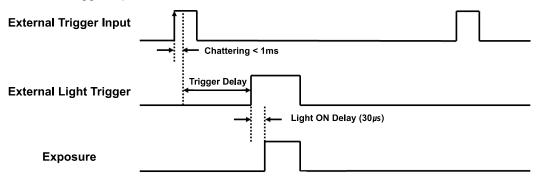

Output Mode


Alarm

Disable


Alarm: In occurrence of vision sensor error, the vision sensor outputs output signal.

Alarm output	Description
Trigger input error	When trigger is input in high camera busy signal, the vision sensor outputs alarm.
Operating time exceeded	When operating time of work group is exceeded set inspection time, the vision sensor outputs alarm.
Work group change error	When unregistered work group number is entered or wrong Clock or Data is input in serial or parallel input, the vision sensor output alarm.
FTP file transmission error	When FTP access error or FTP transmission error in saving inspection result occurs, the vision sensor outpus alarm.

• Camera busy: It is operating status of the camera, after camera trigger input.

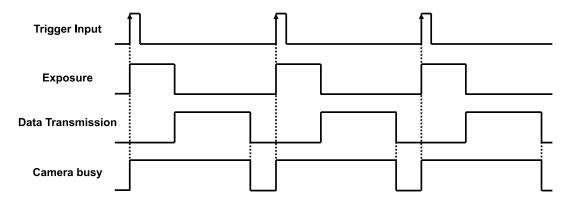

 (2) Control output



You can set control output to NPN/PNP and N.O.(Normally open) / N.C(Normally close).

(3) Pulse type

You can select pulse type for output.

 
You can select pulse type only when the output mode is set to 'Inspection complete', 'Inspection result', or 'Alarm'.


- Pulse: Output signal is output during set output duration.
- Latch: Output signal is kept outputting before next output signal.

(4) Duration

Duration is the time period of maintaining inspection result output signal for.

You can set duration by setting output mode to "Inspection result" and pulse type to "Pulse". Setting range is from 1 to 60,000ms.




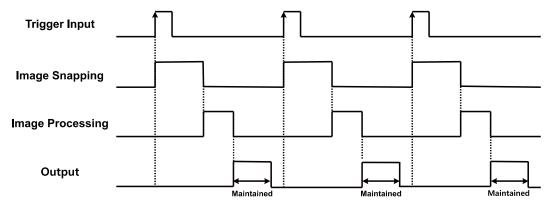


(5) Delay type

Delay type is the moment of applying output delay time to. You can set whether to delay output after inspection completed or to delay output after trigger input.

Delay output after inspection completed

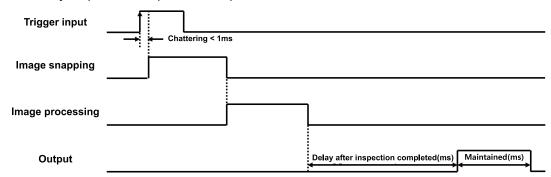

Delay output after trigger input

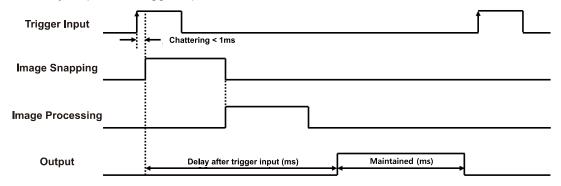


(6) Delay time

Delay time is the time period of delaying inspection result output for, after starting of output delay operation.


- Setting range when delay type is "After inspection completed": 0 to 60,000ms
- Setting range when delay type is "After trigger input": 17 to 60,000ms

 6.6.5 Work Group






(1) Work list

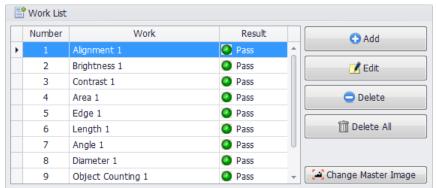

Work list displays a list of the currently registered works and you can register work to inspect and edit or delete the registered works in Work list.


Add: You can register work to inspect. Select inspection type and register.
 Please refer to '6.7 Inspection ' for inspection item setting.

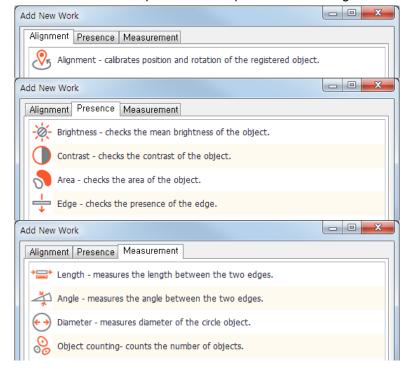


- Edit: Select the registered work in the list and click Edit to edit the work.
- Delete / Delete All: Select the registered work in the list and delete a work or delete all works.
- Change master image: You can change image template of the work to register. The currently displayed image in the image window is registered as master image.




When making new work group and adding work, an image in the image window is registered ads master image.

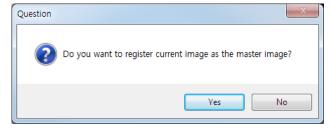

When there is no image in the image window, following error message is displayed and work group is not registered. Take an image with the connected vision sensor or load an image from the PC to register as master image.

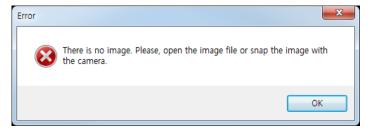

(2) Output inspection result selection

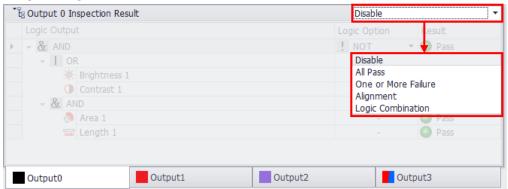


You can set outputting condition of output 0 to 3 settings set in the output menu.

- Disable
- All pass: When all of inspection results are passed, the vision sensor outputs output signal.
- One or more failure: When one or more inspection result is failed to pass, the vision sensor outputs output signal.
- Alignment: When inspection items with alignment are passed, the vision sensor outputs output signal.
- Logic combination: You can set output conditions by setting each logic combination to pass or fail with logical operator.




When setting output with logic combination, set output condition using logical operator for each output.

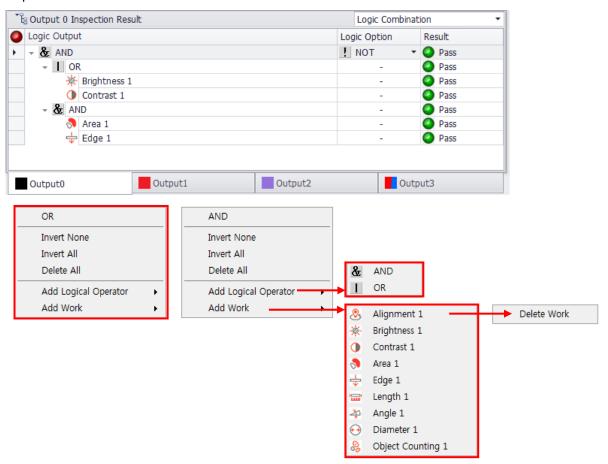

- AND/OR: You can select logic operator.
- Invert none: You can set logical option of all work to NONE(-).
- Invert all: You can set logical option of all work to NOT.
- Delete all/Delete logical operator: You can delete all registered settings of with Delete all and registered logic operator with Delete logical operator.
- Add logical operator: You can add logical operator (AND/OR).
- Add work/Delete work: You can add registered work to logical output or delete work from logical output.

 6.6.6 Inspection






(1) Device


• Start/Stop device inspection: You can activate vision sensor in operation mode and start inspection in registered work group.



• View result image: You can set image to display in the image window during inspection.

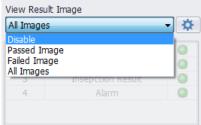

 Save result image: Click the 'Save result image' icon () on the right side in View result image. You can set the result image in local disk of the PC.

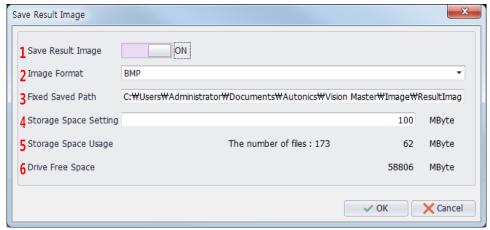

No.	Item	Description
1	Save result image	Sets whether to save inspection result image.
2	Image format	Selects image format to save in. (BMP, PNG, JPG)
3	Fixed saved path	Since saved path is fixed when installing the program, you
		cannot change it.
		Saved path: C:\Users\(Account name)
		\Documents\Autonics\Vision Master\Image\ResultImage

No.	Item	Description
4	Storage space	Checks drive free space and allocates space to save.
	setting	
5	Storage space	Displays the number and volume of the files in storage space.
	usage	
6	Drive free space	Displays drive free space of the PC.


 Output status: Output status displays output status during inspection. You can check output mode and operation status of output.






Please refer to followings when clicking Start device inspection to activate operation mode.


Select operation mode: It is to set operation when starting inspection. You can select whether to save or not to save before starting inspection. When the device is turned off, you can lose unsaved data.

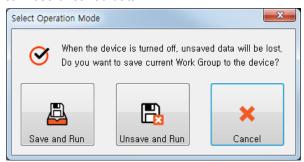

Setting of displaying the inspection image in full screen

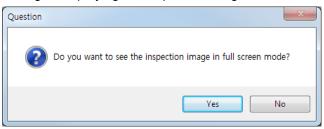

(2) Result Status

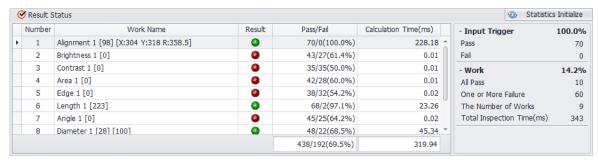

- Work name: Displays work name of inspection items.
- Result: Displays pass/fail for inspection result.
- Pass/Fail: Displays counting of the number of pass/fail and pass rate.
- Operation time: Displays operation time of each inspection item.
- Reset statistics: Resets all statistics about inspection result including pass () / fail () status and operation time.
- Input trigger: Displays statistics of input trigger. It helps you to check input is operating
 in normal status by counting the number of pass/fail status of input trigger.
- Work: Displays statistics of work. It displays the number of inspection result of All pass,
 One or more failure, the number of total work, and inspection time.


6.7 Inspection

Icon	Function	Description	
%	Alignment	To align position and orientation of the target based on the registered target	
	Brightness	To inspect average brightness of the target	
•	Contrast	To inspect average contrast of the target	
0	Area	To inspect area of the target	
1	Edge	To inspect the presence of the edge	
→	Length	To inspect the length between two edges	
₩ °	Angle	To inspect the angle between two edges	
←→	Diameter	To inspect diameter of the circle	
00	Object counting	To count the number of the object	

6.7.1 Alignment

You can use the alignment function to align position and orientation of the target based on the registered target.

Alignment compares features of the registered target and features of the input image to figure out location of similar pattern, and then inspects the input image based on location and rotation angle of the target. It is used to check the presence of inspection target to rotate, to inspect pattern, or to align position of the target.

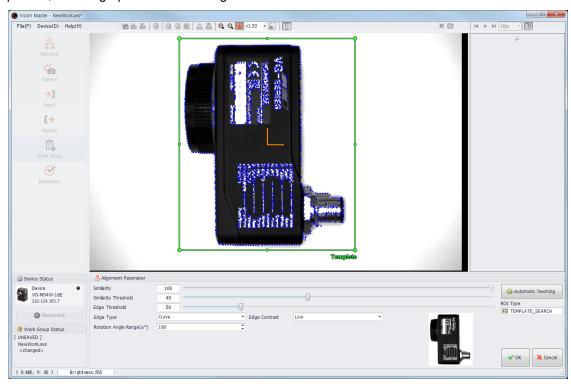

No.	item	Description		
1	Similarity	It is the similarity between registered template and detected template.		
2	Similarity threshold ^{※1}	It is discrimination value of the similarity for deciding pass/fail.		
3	Edge threshold ^{×2}	It is threshold to detect edge.		
4	Edge type	It limits amount of information according to the edge direction Curve: It leads pixels from all edges Straight: It leads pixels only from straight edge.		
5	Edge contrast	It limits amount of edge information according to the contrast value. - High: It uses edges of high contrast. - Medium: It uses edges of high and medium contrast. - Low: It uses edges of high, medium, and low contrast.		
6	Rotation angle range (±°)	It limits detecting area to the set angle range, by setting angle range of the rotated image to detect.		
7	Automatic teaching	It operates teaching automatically, when user changes parameter or adjust ROI.		
8	ROI type	It is type of ROI to inspect. TEMPLATE_SEARCH (template)		
9	OK/Cancel	It registers work to work group or cancel to register.		

- XThreshold is the boundary value when a value is discontinuously changed.
- \times 1. When set template of ROI is 50% similar with the input image in 50 similarity threshold, the vision sensor regards them as the same target and outputs output signal.



 \times 2. Only edges with high contrast can be detected in high edge threshold, while edges with low contrast also can be detected in low edge threshold.



Examples of pass/fail in the alignment inspection

Registering template of inspection target (similarity: 100% / similarity threshold: 80%)



Passed alignment inspection.







Failed alignment inspection.






FAIL



When inspecting inspection items including alignment, alignment is prior to any other inspection items, so that rotating inspection target by alignment also rotates position of other inspection items.

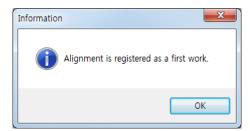

If you want to apply alignment to each inspection, check 'Apply alignment' in the right bottom.



X: moving X axis coordinate / Y: moving Y axis coordinate / R: angle

Examples of pass/fail when inspecting multiple work including alignment

Registering template of the inspection target (registering alignment)



Applying alignment




Unapplying alignment



6.7.2 Brightness

You can use the brightness function to inspect average brightness of the target.

Brightness compares mean brightness of the registered ROI and that of input image ROI. It sets pass range based on the mean brightness value of the registered ROI. The mean brightness value of the inspection target within the pass range is regarded as Pass, while the mean brightness value of the inspection target out of the pass range is regarded as Fail.

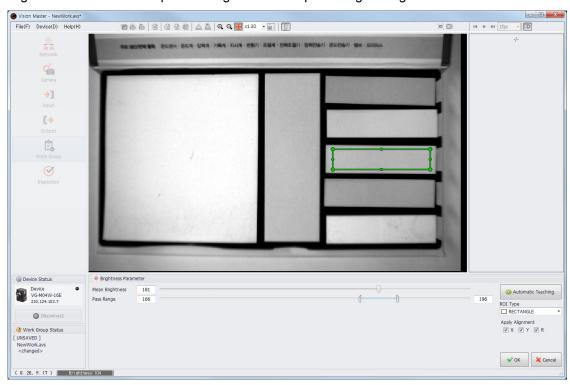


No.	Item	Description			
1	Mean brightness	It displays the mean brightness value of the ROI.			
2	Pass range	It sets the pass/fail range of brightness.			
3	Automatic teaching	Even if user set the pass range, it teaches pass range based on mean brightness of ROI.			
4	ROI type	It sets type of ROI to inspect. RECTANGLE POLYGON CIRCLE (rectangle/polygon/circle)			
5	OK/Cancel	It registers work to work group or cancel to register.			





Examples of pass/fail in the brightness inspection

 Registering template of the inspection target (mean brightness: 181 / pass range: 166 to 196)

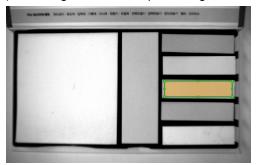



Passed brightness (alignment applied)

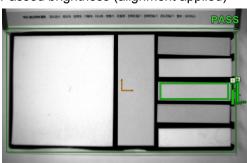


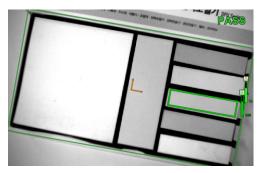

Failed brightness

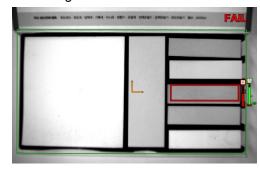

 

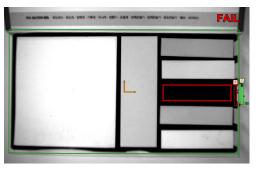


(Below mean brightness of ROI area)

6.7.3 Contrast

You can use contrast function to inspect average contrast of the target.

Contrast is amount of gap between bright part and dark part in the image.

Contrast compares registered ROI contrast and ROI contrast of the input image to figure out changes in contrast. It sets pass range based on the registered contrast value of ROI. The contrast value of the inspection target within the pass range is regarded as Pass, while the contrast value of the inspection target out of the pass range is regarded as Fail. The contrast value is displayed in the percentage.

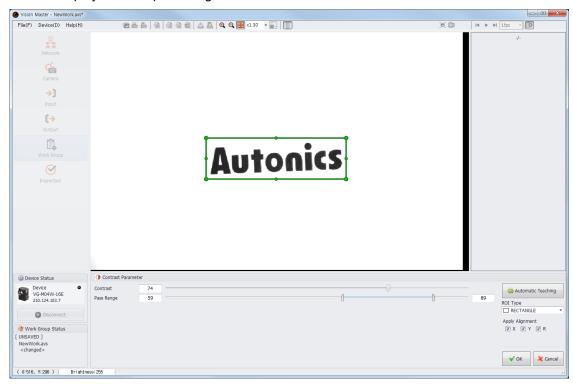

No.	Item	Description		
1	Contrast	It displays the average contrast value of ROI.		
2	Pass range	It sets the pass/fail range of contrast.		
3	Automatic teaching	Even if user set the pass range, it teaches pass range based on the average contrast value of ROI.		
4	ROI type	It sets type of ROI to inspect. RECTANGLE POLYGON CIRCLE (rectangle/polygon/circle)		
5	OK/Cancel	It registers work to work group or cancel to register.		



Examples of pass/fail in the contrast inspection

Registering template of the inspection target (contrast: 74 / pass range: 59 to 89)



Passed contrast (alignment applied)

PASS

PASS





Failed contrast


FAIL



6.7.4 Area

You can use the area function to inspect area of the target.

Area compares difference between registered ROI area and ROI area in the input image. It sets the pass range based on the registered ROI area. The area of the inspection target within the pass range is regarded as Pass, while the area of the inspection target without the pass range is regarded as Fail.

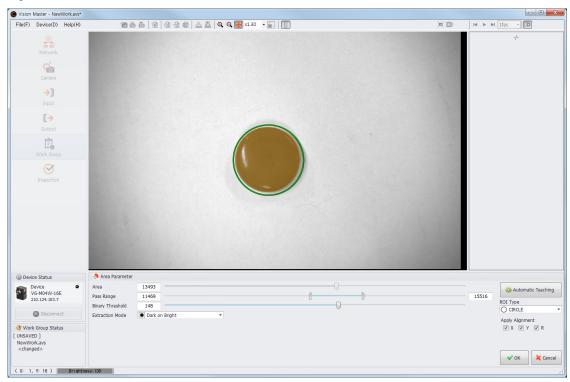

No.	Item	Description				
1	Area	It displays the measured value of ROI area.				
2	Pass range	It sets the	It sets the pass/fail range of area.			
3	Binary threshold ^{×1}	It sets the	It sets the threshold value to detect area.			
		It sets met	hod of detecting area.			
		Item	Dark object on the bright background	Bright object on the dark background		
4	Extraction mode	Descrip tion	Extracting darker area compared to the brightness standard	Extracting brighter area compared to the brightness standard		
4		Image	+	•		
3	Automatic teaching	Even if user set the pass range, it teaches pass range based on the pixel of ROI.				
4	ROI type	It sets type of ROI to inspect. RECTANGLE POLYGON CIRCLE (rectangle/polygon/circle)				

No.	Item	Description		
5	OK/Cancel	It registers work to work group or cancel to register.		


XThreshold is the boundary value when a value is discontinuously changed.

 $\times 1$. Binary threshold means processing inspection with the binary coded threshold value. After converting each pixel of the image under the threshold value to 0 and each pixel of the image over the threshold value to 1, 0 passes the area inspection, while 1 fails to pass the area inspection.



Examples of pass/fail in the area inspection

Registering template of the inspection target (area: 13229 / pass range: 11244 to 15213)

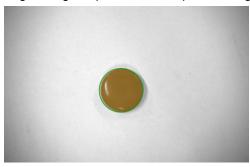

Passed area inspection




Failed area inspection



6.7.5 **Edge**

You can use the edge function to inspect the presence of the edge.

Edge compares directions of the registered edge and edges in the same area of the input image to detect the presence of the edge. It sets the pass range based on the direction of the registered edge. The edge of the inspection target in the pass range is regarded as Pass, while the edge of the inspection target out of the pass range is regarded as Fail.

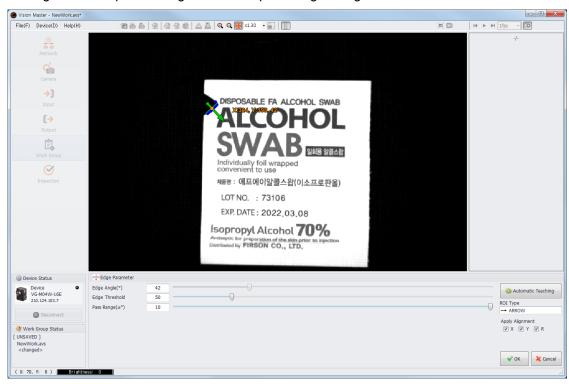

No.	Item	Description		
1	Edge angle(°)	It is the measured angle value of edge grade.		
2	Edge threshold ^{×1}	It sets threshold to detect edge.		
3	Pass range(±°)	It sets the pass/fail range of edge.		
4	Automatic teaching	When user changes parameter or adjust ROI, it teaches automatically.		
5	ROI type	It sets type of ROI to inspect. → ARROW (arrow) Coordinate of X, Y axes of edge is displayed. In the ROI area, the program scans the edge in the arrow direction and firstly detected edge becomes standard for inspection. DISPOSABLE FA ALL X324, Y5193, 42		
6	OK/Cancel	It registers work to work group or cancel to register.		

XThreshold is the boundary value when a value is discontinuously changed.

 \times 1. Only edges with high contrast can be detected in high edge threshold, while edges with low contrast also can be detected in low edge threshold.



Examples of pass/fail in the edge inspection

■ Registering template of the inspection target (edge angle: 42° / pass range: ±10°)



■ Passed edge (alignment applied)






■ Failed edge



6.7.6 Length

You can use the length function to inspect the length between two edges. The length unit is pixel.

Base points of measuring length are two edges on each of two arrows. Length sets the pass range based on the length between two registered edges. The measured length of the inspection target within the pass range is regarded as Pass, while the measured length of the inspection target out of the pass range is regarded as Fail.

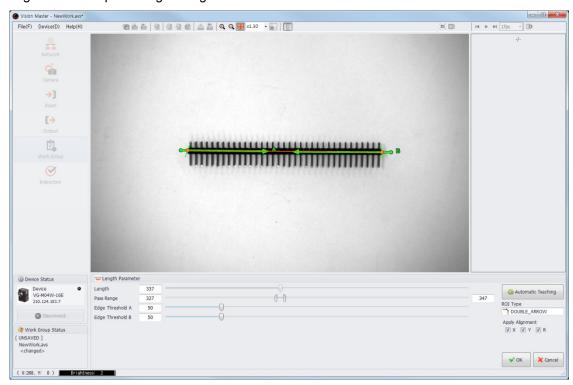

No.	Item	Description		
1	Length	It is the length between two edges of ROI.		
2	Pass range	It sets the pass/fail range of length.		
3	Edge threshold A/B ^{×1}	It sets threshold to detect edge.		
4	Automatic teaching	Even if user set the pass range, it teaches pass range based on the pixel of ROI.		
5	ROI type	It sets type of ROI to inspect. In the ROI area, the program scans the edge in the arrow direction and firstly detected edge becomes standard for inspection. The DOUBLE_ARROW (two arrows)		
6	OK/Cancel	It registers work to work group or cancel to register.		

XThreshold is the boundary value when a value is discontinuously changed.

 $\times 1$. Only edges with high contrast can be detected in high edge threshold, while edges with low contrast also can be detected in low edge threshold.




Examples of pass/fail in the length inspection

Registering template of the inspection target (Length: 386 / pass range: 376 to 396)




Passed length inspection (alignment applied)

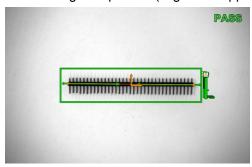



Failed length inspection

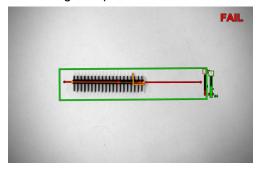


6.7.7 **Angle**

You can use the angle function to inspect the angle between two edges. The unit of angle is $^{\circ}$ (degree).

Angle measures angle of crossing point which is between two edges of registered arrows.

It sets the pass range based on the angle between two registered edges. The measured angle of the inspection target within the pass range is regarded as Pass, while the measured angle of the inspection target out of the pass range is regarded as Fail.

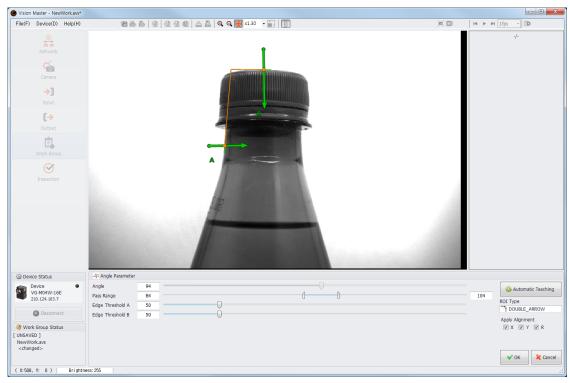

No.	Item	Description		
1	Angle (°)	It is the angle between two edges of ROI.		
2	Pass range	It sets the pass/fail range of angle.		
3	Edge threshold A/B ^{×1}	It sets threshold to detect edge.		
4	Automatic teaching	Even if user set the pass range, it teaches pass range based on the pixel of ROI.		
5	ROI type	It sets type of ROI to inspect. In the ROI area, the program scans the edge in the arrow direction and firstly detected edge becomes standard for inspection. The DOUBLE_ARROW (two arrows)		
6	OK/Cancel	It registers work to work group or cancel to register.		

XThreshold is the boundary value when a value is discontinuously changed.

 \times 1. Only edges with high contrast can be detected in high edge threshold, while edges with low contrast also can be detected in low edge threshold.



Examples of pass/fail in the angle inspection

Registering template of the inspection target (angle: 98° / pass range: 88 to 108°)



Passed angle inspection




■ Failed angle inspection



6.7.8 Diameter

You can use the diameter function to inspect diameter of the circle. The unit of diameter is pixel.


Diameter detects circle in the registered area which is between two circles (minimum and maximum diameter of the circle). The detected diameter within the minimum/maximum area is regarded as Pass, while the detected diameter out of the minimum/maximum area is regarded as Fail.

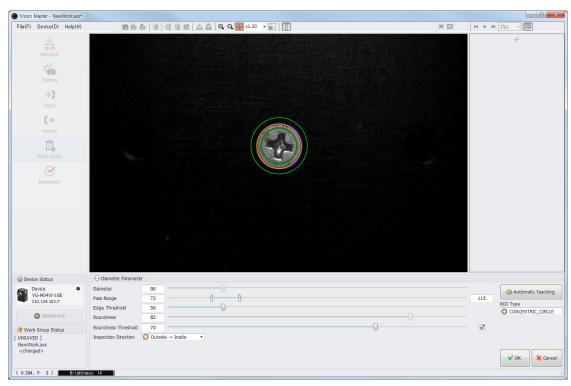

No.	Item	Description			
		It is diameter of the detected circle.			
1	Diameter	Maximum diameter range Minimum diameter range Detected circle			
2	Pass range	It sets pass/fail range of circle.			
3	Edge threshold ^{×1}	It sets threshold to detect edge.			
4	Roundness	It is roundness of the detected circle.			
5	Roundness threshold ^{×2}	It sets threshold to detect circle. It inspects diameter of the circle which of roundness is over the threshold.			

No.	Item	Description			
		It sets method to detect circle. When you setting ROI, two circles are made and area between two circles is the range to detect circle.			
		Item	Outside→Inside	Inside→Outside	
6	Inspection direction	Descripti on	Scanning the pass area from outside to inside. Detecting outermost circle in multiple circles.	Scanning the pass area from inside to outside. Detecting innermost circle in multiple circles.	
		Image	Detected circle	Detected circle	
7	Automatic teaching	When user changes parameter or adjust ROI, it teaches automatically.			
8	ROI type	It sets type of ROI to inspect. © CONCENTRIC_CIRCLE (circle)			
9	OK/Cancel	It registers work to work group or cancel to register.			


- XThreshold is the boundary value when a value is discontinuously changed.
- \times 1. Only edges with high contrast can be detected in high edge threshold, while edges with low contrast also can be detected in low edge threshold.
- \times 2. When roundness threshold is set to 50, an object with 50% of circle shape is regarded as circle.

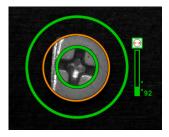



Examples of pass/fail in the diameter inspection

Registering template of the inspection target (diameter: 92, / pass range: 75 to 111)

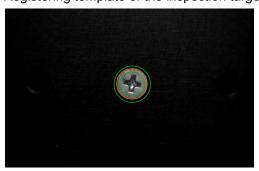

Passed diameter inspection



■ Failed diameter inspection








6.7.9 Object counting

You can use the object counting function to count the number of object.

Object counting counts the number of object in the registered ROI. It regards object with the certain amount of pixel as an object, and compares the number of detected object. The number of detected object within the pass range is regarded as Pass, while the number of detected object out of the pass range is regarded as Fail.

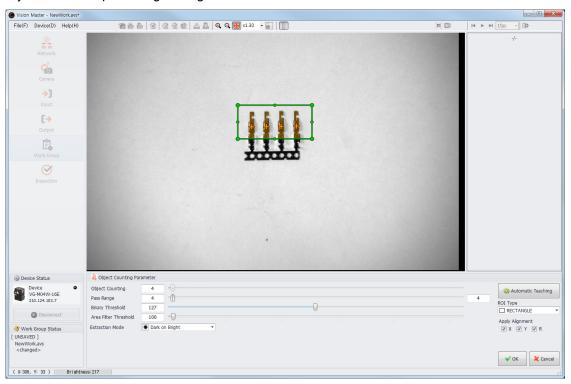

No.	Item	Description				
1	Object counting	It is the nu	It is the number of area in ROI.			
2	Pass range	It sets the	pass/fail range of object counting	g.		
3	Binary threshold ^{×1}	It sets the	threshold value to detect area.			
4	Area filter threshold ^{**2}	It sets the	It sets the standard value for regarding as an area.			
		It sets met	hod of detecting area.			
	Extraction mode	Item	Dark object on the bright background	Bright object on the dark background		
5		Descrip tion	Extracting darker area compared to the brightness standard	Extracting brighter area compared to the brightness standard		
5		Image	+	•		
6	Automatic teaching	When user changes parameter or adjust ROI, it teaches automatically.				
7	ROI type	It sets type of ROI to inspect.				

No.	Item	Description	
		RECTANGLE	
		○ POLYGON	
		○ CIRCLE	(rectangle/polygon/circle)
8	OK/Cancel	It registers work to work group or cancel to register.	


**Threshold is the boundary value when a value is discontinuously changed.

- \times 1. Binary threshold means processing inspection with the binary coded threshold value. After converting each pixel of the image under the threshold value to 0 and each pixel of the image over the threshold value to 1, 0 passes the area inspection, while 1 fails to pass the area inspection.
- \times 2. Area filter threshold regards a group of objects with the number of pixels over the binary threshold as a area.





Examples of pass/fail in the object counting inspection

Registering template of the inspection target (the number of object: 4 / pass range: 4)

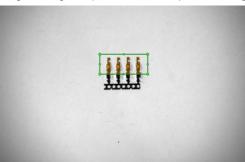


Passed object counting (alignment applied)

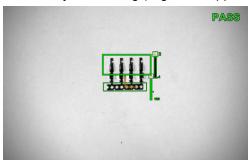


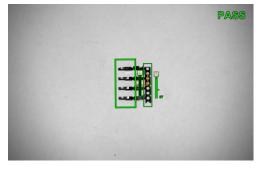


Failed object counting

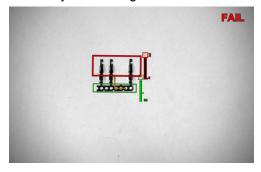


7 Settings

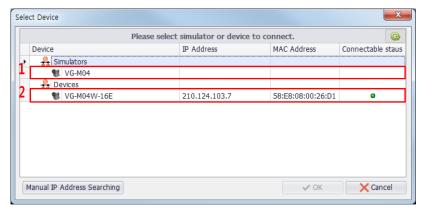

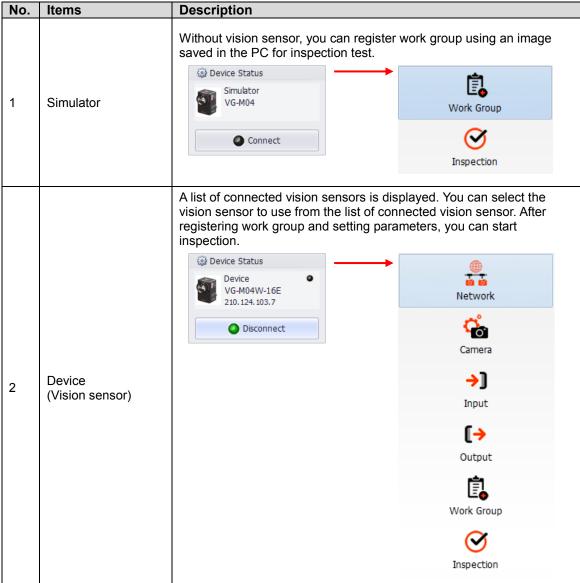


7.1 Simulator

1st After installing Vision Master, select the simulator, 'VG-04', in the Select device window. 2nd Click 'Open image(O)' or 'Open all images from folder(F)' from the File(F) in the menu to load an image to inspect. You can see the loaded image in the image window and preview window in the right side of the screen.

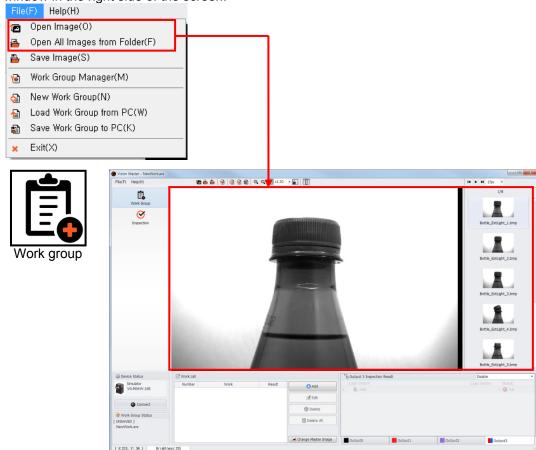


3rd When adding work in the 'work group' setting, click [OK] button in the following pop-up message to register master image. For more details, refer to '6.6.5 Work Group'.

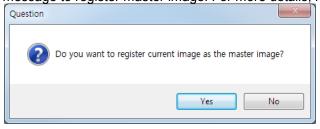

4th Set inspection items. For more details, refer to '6.7 Inspection'.





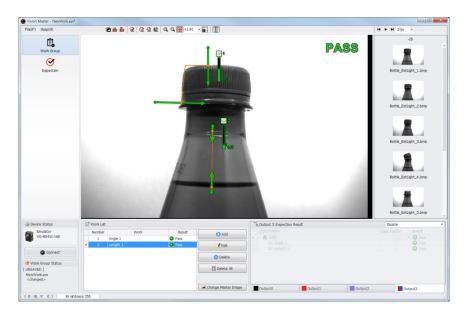


5th Click 'Play' icon (▶) on the top right side.

You can see inspection status in the 'Inspection' setting window by playing the images of the


preview window.



Inspection

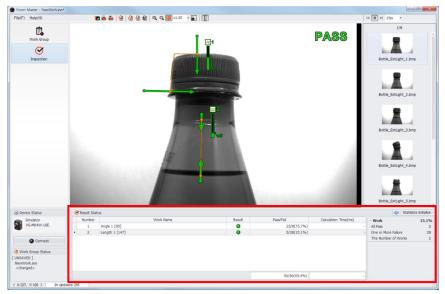

6th You can save work group registered with the simulator in the PC.

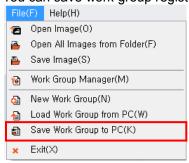


7.2 Device (Vision Sensor)

1st After installing Vision Master, select a device vision sensor) to use from a list of connected devices (vision sensor) by checking IP address.

2nd Click focusing guide in the 'Camera' setting to set the area to focus on, and adjust focus with focus adjuster. When adjusting focus with focusing guide, run Continuous snap ().




Camera

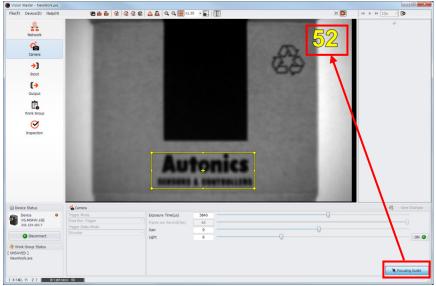

3rd If taken images are dark, set the exposure time longer or light level and gain higher.




Camera

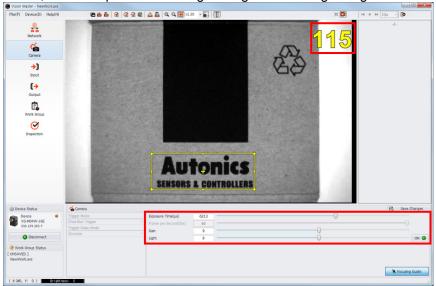

 4th Select the type of input signal which performs as a camera shutter to take image by setting the trigger mode.





Camera

 
5th Set input and output.



Input




Output



6th Add work in the 'work group' setting. For more details, refer to '6.6.5 Work Group'.




Work group

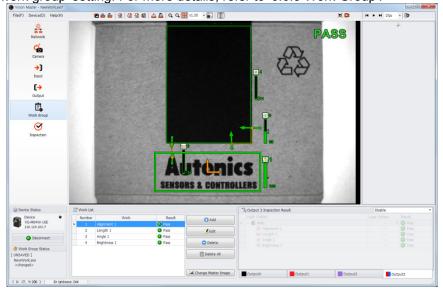

Autonics

7th Before starting inspection, set the result image which is displayed in the image window, and activate Save result image. For more details, refer to '(1) Device' in '6.6.6 Inspection'.



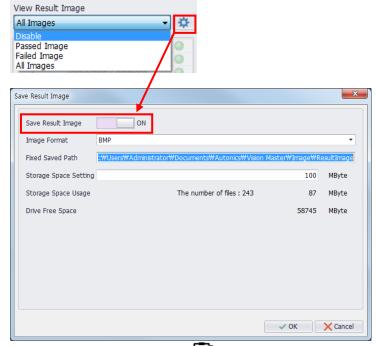



8th Click 'Add taken image to preview window' icon () on the top right side. You can see the images which is being taken by the vision sensor.

9th When you click Start device inspection, Select operation mode window appears. Select between Save and run and Unsave and run for registered work group.




Inspection

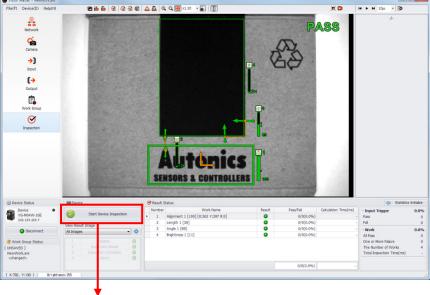

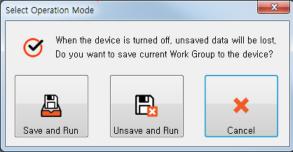


You can also save work group in the File menu to start inspection.

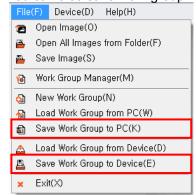

10th Monitor inspection status.



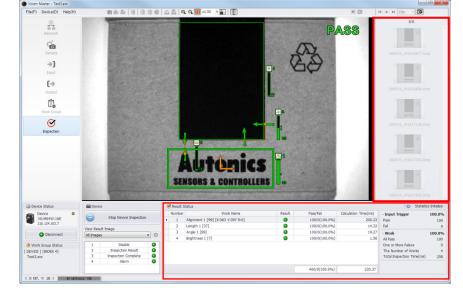

7 Settings Autonics

8 Troubleshooting

Please check routinely whether VG is operating in normal status or not.

No	Symptom	Solution
1		Check that status of power supplying and power cable connections is in normal.
	When supplying power, POWER LED	Check that power is being supplied within the rated range.
	of VG is not turned on.	Check that polarity of power is connected correctly.
		Check that power terminal is tightened thoroughly.
2	VG does not work due to the external	Check that whether status of input COMON or each of input wire connection is in normal.
	input error.	Check that the device connected to input has a problem.
3		Check that output wire is connected correctly.
	VC does not work due to the outernal	Check that power to output is being supplied within the rated range.
	VG does not work due to the external output error.	Check that the device connected to output has a problem.
		Check that specifications of load connected to output is within the rated range.
4		Check that LINK LED is turned on. If not, check wiring.
	Error occurs in Ethernet communication.	Check that communication (IP address, subnet mask, and gateway) is set correctly. Refer to '6.3.5 Network setting' to set correctly.
		Check that connection or specification of the communication cable is corresponding to that of Autonics guide. Use the Autonics cable (sold separately).

Autonics Sensors & Controllers

www.autonics.com

Distributor

- Corporate Headquarters

 18, Bansong-ro 513 Beon-gil, Haeundae-gu, Busan, South Korea 48002

 Brazil Autonics do Brasil Comercial Importadora e Exportadora LTDA

 Tel: 55-11-2307-8480, 3195-4610 / Fax: 55-11-2309-7784 / E-mail: comercial@autonics.com.br

 China Autonics electronic(Jiaxing) Corporation

 Tel: 86-21-5422-5969 / Fax: 86-21-5422-5961 / E-mail: china@autonics.com

 India Autonics Automation India Private Limited

 Tel: 91-22-2768-2570 / E-mail: india@autonics.com

 Indonesia PT. Autonics Indonesia

 Tel: 62-21-8088-8814/5 / Fax: 62-21-8088-4442/0 / E-mail: indonesia@autonics.com

 Iran Autonics Corp. Iran Representative Office

 Tel: 98-21-8872-7251/2 / Fax: 98-21-8872-8556 / E-mail: iran@autonics.com

 Japan Autonics Japan Corporation

 Tel: 81-3-6435-8380 / Fax: 81-3-6435-8381 / E-mail: ja@autonics.com

 Malaysia Mal-Autonics Sensor Sdn. Bhd.

 Tel: 60-3-7805-7190 / Fax: 60-3-7805-7193 / E-mail: malaysia@autonics.com

 Mexico Autonics Mexico S.A. DE C.V

 Tel: 52-55-5207-0019 / Fax: 52-55-1663-0712 / E-mail: ventas@autonics.com.mx

 Russia Autonics Rus

 Tel/Fax: 7-495-660-10-88 / E-mail: russia@autonics.com

 USA Autonics Otomasyon Ticaret Ltd. Sti.

 Tel: 90-216-365-9117/34 / Fax: 90-216-365-9112 / E-mail: turkey@autonics.com

 USA Autonics USA, Inc.

 Tel: 1847-860-8160 / Fax: 1-847-680-8155 / E-mail: vietnam@autonics.com

- \blacksquare Any proposal for a product improvement and development: Product@autonics.com
- Dimensions or specifications on this manual are subject to change and some models may be discontinued without notice.