Autonics

DIGITAL PANEL METER M4W SERIES

INSTRUCTION MANUAL



Thank you for choosing our Autonics products. Please read the following safety considerations before use.

Safety Considerations

XPlease observe all safety considerations for safe and proper product operation to avoid hazards.

*Safety considerations are categorized as follows.

 Marning Failure to follow these instructions may result in serious injury or death. Failure to follow these instructions may result in personal injury **^Caution** or product damage.

XThe symbols used on the product and instruction manual represent the following. ⚠ symbol represents caution due to special circumstances in which hazards may occur.

∧ Warning

1. Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss. (e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime/disaster prevention devices, etc.)

Failure to follow this instruction may result in fire, personal injury, or economic loss.

- 2. Install on a device panel to use.
- Failure to follow this instruction may result in electric shock or fire.
- 3. Do not connect, repair, or inspect the unit while connected to a power source. Failure to follow this instruction may result in electric shock or fire.
- 4. Check 'Connections' before wiring.
- Failure to follow this instruction may result in fire.
- 5. Do not disassemble or modify the unit.

Failure to follow this instruction may result in electric shock or fire.

∧ Caution

1. When connecting the power/measurement input and relay output, use AWG 24 (0.20mm²) to AWG 15(1.65mm²) cable and tighten the terminal screw with a tightening torque of 0.98 to 1.18N·m.


Use proper cables for the rated load current.

Failure to follow this instruction may result in fire or malfunction due to contact failure.

- 2. Use the unit within the rated specifications.
- Failure to follow this instruction may result in fire or product damage. 3. Use dry cloth to clean the unit, and do not use water or organic solvent. Failure to follow this instruction may result in electric shock or fire.
- 4. Do not use the unit in the place where flammable/explosive/corrosive gas, humidity, direct sunlight, radiant heat, vibration, impact, or salinity may be present.
- Failure to follow this instruction may result in fire or explosion.
- 5. Keep metal chip, dust, and wire residue from flowing into the unit. Failure to follow this instruction may result in fire or product damage.

Dimensions

(unit: mm)

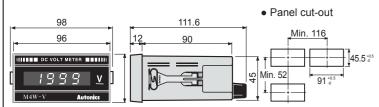

- XThe above specifications are subject to change and some models may be discontinued without notice.
- ※Be sure to follow cautions written in the instruction manual and the technical descriptions (catalog, homepage)

Specifications

Model			M4W-DV- M4W1P-DV- M4W2P-DV-	M4W-AA- M4W1P-AA- M4W2P-AA-	M4W-DA- M4W1P-DA- M4W2P-DA-	M4W-W- M4W1P-W- M4W2P-W-	M4W-T-[]-[] M4W1P-T[]-[] M4W2P-T[]-[]	M4W-S-□-□ M4W1P-S□-□ M4W2P-S□-□	M4W-DI M4W1P-DI M4W2P-DI	M4W-P
May allo	wable input	Max. 400VAC \sim	Max. 300VDC=	Max. AC 5A	Max. DC 2A	Max. 10VDC=	Max. 10VDC≔,	Max. 10VAC∼	DC4-20mA	DC4-20mA
IVIAX. AIIO	wabie iriput	150% for each input specification(at 400VAC~:120%)								
Max. display range		Max. 1999								-0.50~1.00~ +0.50cosø
Measurement function		AC voltage	DC voltage	AC current	DC current	AC watt	rpm	Speed	Scaling meter	Power factor
Power supply		110/220VAC~ 50/60Hz(Option:100-240VAC~ 50/60Hz, 24-70VDC==)								
Allowable voltage range		90 to 110% of rated voltage								
Power consumption		M4W-DC: 2W, AC: 4VA / M4W1P, 2P-DC: 3W, AC: 5VA								
Display method		7Segment LED Display(Charachter height: 14mm)								
Sampling cycle		300ms								
A/D conversion method		Dual slope intergal method								
Response time		2sec(0 to Max.)								
Sampling times		2.5 times/sec								
Insulation resistance		Over 100MΩ(at 500VDC megger)								
Dielectric strength		2000VAC 50/60Hz for 1 minute								
Noise immunity		±1kV the square wave noise(pulse width:1μs) by the noise simulator								
Vibration	Mechanical	0.75mm amplitude at frequency of 10 to 55Hz in each X, Y, Z directions for 1 hour								
	Malfunction	0.5mm amplitude at frequency of 10 to 55Hz in each X, Y, Z directions for 10 minutes								
Shock	Mechanical	300m/s²(approx. 30G) in each X, Y, Z direction for 3 times								
	Malfunction	100m/s²(approx. 10G) in each X, Y, Z direction for 3 times								
	Ambient temperature	-10 to 50°C, storage: -25 to 65°C								
-ment	Ambient humidity	35 to 85%RH, storage: 35 to 85%RH								
Relay	Mechanical	Min. 10,000,000 times								
I — -	Electrical	Min. 100,000 times(250VAC 3A resistive load)								
Output capacity		M4W: Non, M4W1P: Relay contact output 250VAC 3A 1c, M4W2P: Relay contact output 250VAC 3A 1c×2								
Display accuracy		DC: F.S. ±0.2% r	dg ±1Digit 23°C ±	5°C, AC: F.S. ±0.5	5% rdg ±2Digit 23	°C ±5°C	F.S.±0.3% rdg ±	1Digit 23°C ±5°C		F.S. ±3% rdg ±1Digit
Unit weight		M4W: Approx. 168g, M4W-P: Approx. 268g, M4W1P: Approx. 253g, M4W2P: Approx. 278g								

Environment resistance is rated at no freezing or condensation.

input range

Measurment function

Measuring input

199.9mV | 1.999V | 19.99V

_ | 1999m/min | 1999m/min | _

Output

Digit

Measuring input range

1999 -

used with Tacho-generator.

then check the cables

-0.50~1.00~+0.50

※2: 1-5VDC measuring input is optional.

Range Blank 1

Model

AV(R)

AA(R)

DV

DA

T(R)

S(R)

DI^{※2}

Blank

Ordering Information

M 4 W 1P - A V R - 6

Connections

M4W1P

Number Refer to Measuring input range

AVG value

RMS value

Voltage

Current

Tachomete

Line Speed

Power Facto

Single preset

DIN W96×H48mn

1999(3½ Digit)

400V __

Dual preset

Indicator

Meter

199.9V

19.99mA 199.9mA 1.999A 19.99A 199.9A 1999A —

1.999kW 19.99kW 199.9kW 1999kW —

1: 0 to 10VDC Measuring input

X: Measuring input except 1, 2

199.9mV | 1.999V | 19.99V | 199.9V | 300V | —

1999rpm | 1999rpm | 2: 0 to 10VAC Measuring input

×1: When the output of power converter is 10VDC, measuring input value is maximum.

**Power converter should be used with Watt meter and Tachometer/Line speed meter should be

*When "1999" or "1999" is flashes with a certain measurement input, disconnect power supply and


In case that output is DC4-20mA, scaling meter should be used.

DC Type


AC Type


Watt

XUse teminals of size specified below. Min Max

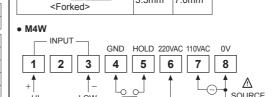

3 5mm | 7 0mm

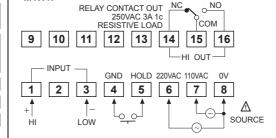

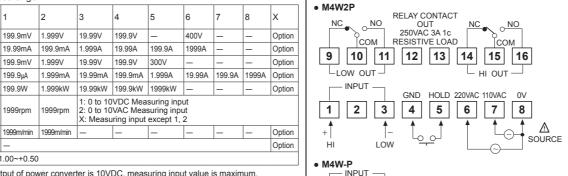

1 2 3 4 5 6 7


220VAC 110VAC

8

Δ

SOURCE

DC SMPS AC SMPS 678 6 7 8 <u>_</u> SOURCE SOURCE SOURCE 24-70VDC 100-240VAC 50/60Hz 4VA

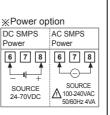


DC SMPS AC SMPS 678678 SOURCE SOURCE SOURCE 24-70VDC 100-240VAC

Connections of Applications

○ Simultaneous connection of voltmeter and ammeter

For DC power supply

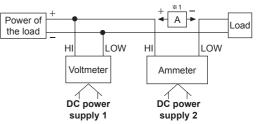



X1: Compared to measurement input range, higher measuring voltage needs a multiplier and lower measuring voltage needs a shunt.

*When using voltmeter and ammeter simultaneously, connect the separated power supply each.

X(-) terminal of the power and (-) terminal of measurement input are shorted

For AC power supply

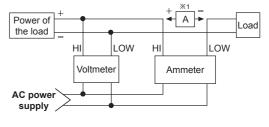

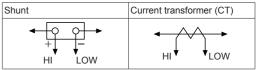

X1: When measuring higher current than measurement input, use a shunt for DC current and a current transformer (CT) for AC current.

Cautions during Use


1. Follow instructions in 'Cautions during Use'.

Otherwise, it may cause unexpected accidents

2. Install a power switch or circuit breaker in the easily accessible place for supplying or disconnecting the power.

3. Keep away from high voltage lines or power lines to prevent inductive noise. In case installing power line and input signal line closely, use line filter or varistor at power line and shielded wire at input signal line.

Do not use near the equipment which generates strong magnetic force or high frequency noise

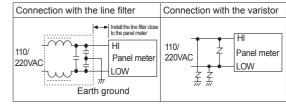

4. This unit may be used in the following environments.

①Indoors (in the environment condition rated in 'Specifications')

@Altitude max 2 000m

③Pollution degree 2

4 Installation category II

Major Products

■ Photoelectric Sensors ■ Temperature Controllers

Fiber Optic Sensors Temperature Ontrollers

Door Sensors SSRs/Power Controllers

Counters

■ Area Sensors ■ Timers ■ Proximity Sensors ■ Panel Meters ■ Tachometer/Pulse (Rate) Meters

Rotary Encoders
Connector/Sockets
Switching Mode Power Supplies
Control Switches/Lamps/Buzzers

■ I/O Terminal Blocks & Cables

■ Stepper Motors/Drivers/Motion Controller

■ Stepper Motion Priversimotion Controllers
■ Graphic/Logic Panels
■ Field Network Devices
■ Laser Marking System (Fiber, Co₂, Nd: YAG)
■ Laser Welding/Cutting System

Autonics Corporation ■ HEADQUARTERS:

TEL: 82-51-519-3232

DRW170802AA